F
294
.S594
C46
2012

Phase I Historic Resource Survey

Social Circle, Georgia

August 2012



UGA
CE+D

The University of Georgia
College of Environment + Design
Center for Community Design & Preservation
Phase I Historic Resource Survey
Social Circle, Georgia

Owens Library
College of Environment & Design
University of Georgia

Credits

Report Submitted to:
Georgia Department of Transportation
Office of Environmental Services
One Georgia Center, 16th Floor
600 West Peachtree Street, NW
Atlanta, GA 30308

Report Prepared by:
Center for Community Design & Preservation (CCDP)
http://www.ced.uga.edu/pso
225 W Broad Street
Athens, GA 30062

Pratt Cassity – Principal Investigator
Laura Kviklys – Project Coordinator

Emily Laborde, MHP, Field Surveyor, Report creation
Fielding Link, Master of Landscape Architecture Candidate, Field Surveyor, Report Creation
Kristin Porter, Master of Historic Preservation Candidate, Field Surveyor, Report Creation
Milton Perry, Master of Landscape Architecture Candidate, Field Surveyor, Report Creation
Thomas Peters, Master of Landscape Architecture Candidate, Field Surveyor, Report Creation
Caty Rushing, Master of Historic Preservation Candidate, Report Creation
Eleonora Machado, CCDP Graphics Coordinator, Report design and layout

Table of Contents

Page 4	List of Figures
Page 4	List of Tables
Page 5	Introduction
Page 7	Project Description
Page 8	Methodology
Page 9	National Register of Historic Places Evaluation Criteria
Pages 10-19	Mid-century Resources
Pages 21-40	Survey Results
Page 42	Integrity
Page 43	Conclusion
Pages 44-228	Resources
Page 229	Bibliography

List of Figures

Figure 1. Survey Area for the City of Social Circle	Page 6-7
Figure 2. American Small House Example	Page 10
Figure 3. Ranch House Example	Page 10
Figure 4. Late Period Bungalow	Page 10
Figure 5. Identified Ranch Houses within Social Circle, GA	Page 17
Figure 6. All Identified Resources within Social Circle, GA	Page 22
Figure 7. All Identified Resources by Date	Page 23
Figure 8. National Register for Historic Places Eligibility of Resources	Page 24

List of Tables

Table 1. Identified Mid-century Resources	Pages 12-14
Table 2. Mid-Century Resources Age Distribution	Page 15
Table 3. Mid-Century Resources Age Distribution by Percent	Page 15
Table 4. Mid-Century Resources Use	Page 16
Table 5. Mid-Century Residential House Types	Page 16
Table 6. Field Survey Results, Description of all Identified Resources	Pages 25-33
Table 7. Field Survey Results, All Identified Resources, Use	Page 33
Table 8. Field Survey Results, All Identified Resources, Use Percentages	Page 34
Table 9. Field Survey Results, All Identified Resources, Age Distribution	Page 35
Table 10. Field Survey Results, All Identified Resources, Construction Date by Percentage	Page 36
Table 11. Field Survey Results, All Identified Resources, Residential Building Types	Page 37
Table 12. Field Survey Results, All Identified Resources, Residential Building Type By Percentage	Page 38
Table 13. Field Survey Results, All Identified Resources, Architectural Styles	Page 39
Table 14. Field Survey Results, All Identified Resources, Architectural Styles by Percentage	Page 40

Introduction

What is a cultural resource survey?



The Georgia Historic Resources Survey is an ongoing, statewide survey of buildings, sites, structures, and objects of historical, architectural and cultural significance. The Georgia Survey is one of the programs administered by the Historic Preservation Division of the Department of Natural Resources (HPD).

Completed surveys can be used to identify individual buildings and districts for possible listing in the Georgia Register of Historic Places; assist the preservation efforts of Georgia's Certified Local Governments; support local designations of buildings and districts; expedite review by governmental agencies; aid preservation and land-use planning; and promote research of the state's history and architecture.

A goal of an historic resources survey is to collect a minimum level of information needed statewide for preservation activities. This basic, standard survey does not gather all the kinds of information needed in local preservation planning, environmental review, National Register nominations, or historical research, but serves as the foundation for these preservation activities.[1]

[1]<>. "Georgia Historic Resources Survey Manual," Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2000.

Figure 1. Survey Area for the City of Social Circle



Project Description

The Center for Community Design and Preservation (CCDP) located within the University of Georgia's College of Environment + Design (CED) conducted a Phase I historic resource survey of the City of Social Circle, Georgia in August 2012. The project area covered the approximately 11.2 square miles within city limits which is located in both Walton and Newton Counties. The city is approximately 45 miles east of Atlanta and approximately four miles due north of Interstate 20.

The resource survey was performed by historic preservation professionals, and graduate students in the Maters of Historic Preservation program (MHP) and the Masters of Landscape Architecture program (MLA) at the CED. The survey consisted of background research, with particularly heavy focus on the 2002-2003 DNR survey for the City of Social Circle, and the 1981 National Register of Historic Places Inventory of Social Circle. The survey also included windshield and pedestrian field work, data collection and analysis. The survey identified and documented all resources within city limits including resources which have surpassed 45 years in age since the 2002-2003 survey, as well as those properties previously surveyed for present architectural integrity and use. All Ranch Houses constructed before 1970 that met the minimum standard for architectural integrity were also documented.

The information collected by the field survey was entered into Georgia's Natural, Archaeological, and Historic Resources Geographical Information System (GNAHRGIS), a web-based geographical information system designed to store and display information about Georgia's cultural resources. GNAHRGIS is the repository for all of the current statewide historic resource data. The survey information was entered under survey ID 2207, "New Survey for Social Circle, Ga" and can be accessed at www.gnahrgis.org.

Methodology

The survey was conducted according to the procedures outlined in ***The Georgia Historic Resources Survey Manual***. Prior to fieldwork, an evaluation of the survey area was conducted using the 2002-2003 Georgia Historic Resources survey report of the City of Social Circle. The survey area was assessed for properties listed in the National Register for Historic Places, and GIS data obtained from the City of Social Circle was used to identify potentially historic parcels and structures in combination with USGS base maps indicating structures built prior to 1981.

The area was surveyed over the course of several days with a systematic coverage of the project area. Each resource within the assigned boundaries was assessed for historic significance and architectural integrity. A Georgia Historic Resources survey from was completed for all buildings having a minimum level of architectural integrity. A structure with architectural integrity is one that generally maintains its original location, design, setting, materials, workmanship, feeling and association. Properties with a significant loss of physical integrity, or those lacking historic significance were not surveyed. The physical condition of structures was not a consideration for identification for resources which retained architectural integrity. All identified and documented resources were approximately 50 years old or older, with the exception of Ranch Houses with a construction date prior to 1970. All properties were surveyed from the public right of way and assigned an identification number then documented with the completion of a Georgia Form, as well as, photo documentation and corresponding georeferencing data. The survey form includes information about the use, style, floor plan, materials, context, physical description and an accurate age determination of date of construction and additions. Dates of construction are giving in decade increments because of the difficultly to pinpoint specific dates of construction completion based solely on field analysis, and the prevalence of stylistic element changes. Sources utilized for age determination and architectural style and type description included Lee and Virginia McAlester's *A Field Guide to American Houses, the Georgia Historic Resources Survey Manual, Georgia's Living Places*[1] and *A Visual Guide to Architecture* by Francis D. K. Ching.

Criteria for Evaluation

National Register for Historic Places

Each resource was evaluated for potential listing in the National Register of Historic Places (NRHP). The criteria for listing are outlined in the National Register Bulletin *How to Apply the National Register Criteria for Evaluation* published by the U.S Department of Interior, National Park Service. Cultural resources can be defined as eligible for the NRHP if they:

A. Are associated with events that have had a significant contribution to a broad pattern of history; or
B. Are associated with the lives of persons significant in the past;
C. Embody distinctive characteristics of a type, period, or method of construction, or represent the work of a master, possess high artistic values, or represent a significant and distinguished entity whose components may lack distinction; or
D. Have yielded or may be likely to yield, information important to history or prehistory.[1]

Ordinarily cemeteries, birthplaces, or graves of historical figures, properties owned by religious institutions or used for religious purposes, structures that have been moved from their original locations, reconstructed historic buildings, properties primarily commemorative in nature, and properties that have achieved significance within the last 50 years are not considered for the National Register. However, properties will qualify if they are integral parts of districts that do meet the criteria or they fall within the following categories:

a. A religious property deriving primary significance from architectural or artistic distinction or historical importance; or
b. A building or structure removed from its original location but which is significant primarily for architectural value, or which is the surviving structure most importantly associated with a historic person or event; or
c. A birthplace or grave of a historical figure of outstanding importance if there is no appropriate site or building directly associated with his or her productive life; or
d. A cemetery which derives its primary significance from graves or persons of transcendent importance, from age, from distinctive design features, or from association with historic events; or
e. A reconstructed building when accurately executed in a suitable environment and presented in a dignified manner as part of a restoration master plan, and when no other building or structure with the same association has survived; or
f. A property achieving significance within the last 50 years if it is of exceptional importance.

For a property to qualify for the National Register it must meet one of the National Register Criteria for Evaluation by:

- Being associated with an important historical **context** *and*
- Retaining historic integrity of those features to convey its significance.

To determine whether a property or site retains integrity, it needs to be evaluated for the aspects of its location, design, setting, workmanship, materials, feeling, and association to convey its historic significance.[2]

[1] The Criteria for Evaluation are found in the *Code of Federal Regulations, Title 36, Part 60*, reprinted in U.S. Department of Interior, National Park Service, *National Register Bulletin: How to Apply the National Register Criteria for Evaluation*, Washington, D.C., 1997, p. 2-3.
[2] A complete list of areas of significance can be accessed at http://www.nps.gov/nr/publications/bulletins/nrb15/nrb15_5.htm



Figure 2. American Small House Example



Figure 3. Ranch House Example



Figure 4. Late Period Bungalow

Post War residential House Types

The American Small House

The Ranch House

The Bungalow

MID CENTURY RESOURCES

POST WAR RESIDENTIAL HOUSE TYPES

Two residential house types were commonly built in Georgia following World War Two: The American Small House (side gabled cottage), and the Ranch House. These house types were indicative of the rapid building of residential structures in the Post War period.

THE AMERICAN SMALL HOUSE

Built primarily from the late 1930s to the early 1950s, the American Small House is a small, detached single-family home. Architecturally, it is compact, nearly square although sometimes rectangular in plan, one story high, usually gable roofed, simply and tightly massed, and simply detailed.[1] Although the period of construction spans approximately 20 years, the bulk of American Small Houses in Georgia were constructed in the late 1940s.

THE RANCH HOUSE

The vast majority of Ranch Houses in Georgia were constructed after 1945, most prominently during the period between 1950 and 1975. The Ranch House has a long, narrow, rectangular shape with or without projections. Bedrooms are typically clustered at one end, the principle entry and living spaces near the center, and the garage or carport at the other end.[2] Thousands of examples of this type are represented in Georgia, making it one of the most ubiquitous house types in the state.

THE BUNGALOW

A third house type, the Bungalow, was built sporadically during this period, and was a continuation of designs from the 1920s and 1930s.

[1] <>. The American Small House, Georgia Department of Natural Resources, Historic Preservation Divison, 2008. Accessed at http://georgiashpo.org/sites/uploads/hpd/pdf/American_Small_House.pdf, September 2012.

[2] <> Georgia Historic Resource Survey Manual: House Types in Georgia, Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 12.

SC-ID	GNAHRGIS ID	Age	NRHP Eligibility	Latitude	Longitude
28	240249	1950-1959	Not Eligible	33.6656	-83.7127
30	240253	1955-1964	Not Eligible	33.6477	-83.7225
31	240255	1950-1959	Not Eligible	33.6501	-83.7221
32	240256	1955-1964	Not Eligible	33.6506	-83.7219
48	*240287*	*1955-1964*	*Potentially Eligible*	*33.6591*	*-83.7115*
49	*240288*	*1955-1964*	*Potentially Eligible*	*33.6588*	*-83.7120*
51	240898	1955-1964	Not Eligible	33.6673	-83.7160
53	240311	1965-1974	Not Eligible	33.6671	-83.7291
59	240358	1950-1959	Not Eligible	33.6675	-83.7238
60	240904	1955-1964	Not Eligible	33.6680	-83.7179
61	240359	1965-1974	Not Eligible	33.6675	-83.7282
62	240361	1965-1974	Not Eligible	33.6675	-83.7282
65	240905	1950-1959	Not Eligible	33.6815	-83.7044
67	240907	1970-1979	Not Eligible	33.6815	-83.7044
68	240448	1970-1979	Not Eligible	33.6815	-83.6815
69	240449	1975-1984	Not Eligible	33.6815	-83.7044
70	240450	1960-1969	Not Eligible	33.6817	-83.7052
72	*240454*	*1960-1969*	*Potentially Eligible*	*33.6802*	*-83.7034*
73	240455	1965-1974	Not Eligible	33.6808	-83.7034
86	240271	1945-1954	Not Eligible	33.6576	-83.7225
88	240272	1970-1979	Not Eligible	33.6575	-83.7224
89	240274	1970-1979	Not Eligible	33.6569	-83.7233
91	240908	1945-1954	Listed	33.6567	-83.7197
93	240909	1970-1979	not Eligible	33.6563	-83.7191
103	240910	1960-1969	Not Eligible	33.6536	-83.7221
106	240911	1965-1974	Not Eligible	33.6531	-83.7232
107	240432	1950-1959	Not Eligible	33.6529	-83.7235
109	240433	1955-1964	Not Eligible	33.6527	-83.7282
110	240434	1965-1974	Not Eligible	33.6514	-83.7274
111	240435	1965-1974	Not Eligible	33.6513	-83.7268
114	240437	1950-1959	Not Eligible	33.6523	-83.7248
125	240382	1950-1959	Not Eligible	33.6495	-83.7275
126	240944	1965-1974	Not Eligible	33.6491	-83.7272
127	240385	1950-1959	Not Eligible	33.6489	-83.7279
130	240397	1950-1959	Not Eligible	33.6467	-83.7298
131	240398	1965-1974	Not Eligible	33.6409	-83.7235
132	240401	1960-1969	Not Eligible	33.6418	-83.7270
133	240402	1965-1974	Not Eligible	33.6417	-83.7270
134	240403	1965-1974	Not Eligible	33.6423	-83.7268
135	240404	1970-1979	Not Eligible	33.6424	-83.7267
136	240405	1965-1974	Not Eligible	33.6424	-83.7267
137	240406	1965-1974	Not Eligible	33.6428	-83.7266
138	240407	1965-1974	Not Eligible	33.6478	-83.7265
139	240408	1965-1974	Not Eligible	33.6429	-83.7260

Table 1. Identified Mid-century Resources


SC-ID	GNAHRGIS ID	Age	NRHP Eligibility	Latitude	Longitude
140	204409	1965-1974	Not Eligible	33.6429	-83.7260
141	240410	1965-1974	Not Eligible	33.6420	-83.7557
142	240412	1965-1974	Not Eligible	33.6420	-83.7557
143	240413	1965-1974	Not Eligible	33.6420	-83.7255
146	240415	1965-1974	Not Eligible	33.6546	-83.7194
147	240416	1970	Listed	33.6539	-83.7206
148	240424	1955-1964	Not Eligible	33.6553	-83.7195
149	240425	1955-1964	Not Eligible	33.6557	-83.7222
150	240426	1955-1964	Not Eligible	33.6561	-83.7228
151	240427	1965-1974	Not Eligible	33.6556	-83.7249
152	240428	1965-1974	Not Eligible	33.6567	-83.7233
153	240429	1975-1984	Not Eligible	33.6554	-83.7275
154	240230	1975-1984	Not Eligible	33.6562	-83.7289
155	240438	1975-1984	Not Eligible	33.6569	-83.7278
156	240439	1975-1984	Not Eligible	33.6564	-83.7264
157	240440	1975-1984	Not Eligible	33.6564	-83.7265
158	240441	1975-1984	Not Eligible	33.6546	-83.7161
164	240245	1955-1964	Not Eligible	33.6563	-83.7187
181	240381	1955-1964	Not listed	33.6553	-83.7193
191	240912	1965-1974	Not Eligible	33.6515	-83.7146
192	*240400*	*1945-1954*	*Potentially Eligible*	*33.6573*	*-83.7170*
193	*240417*	*1950-1959*	*Potentially Eligible*	*33.6572*	*-83.7167*
195	*240419*	*1945-1954*	*Potentially Eligible*	*33.6570*	*-83.7163*
203	240504	1960-1969	Not Eligible	33.6620	-83.7265
204	240505	1960-1969	Not Eligible	33.6628	-83.7269
206	240519	1965-1974	Not Eligible	33.6639	-83.7278
207	240521	1965-1974	Not Eligible	33.6632	-83.7275
208	240522	1965-1974	Not Eligible	33.6631	-83.7271
209	240523	1970-1979	Not Eligible	33.6628	-83.7269
210	240524	1965-1974	Not Eligible	33.6627	-83.7269
211	240525	1965-1974	Not Eligible	33.6622	-83.7267
212	240527	1965-1974	Not Eligible	33.6620	-83.7264
220	240550	1955-1964	Not Eligible	33.6534	-83.7226
221	240562	1955-1964	Not Eligible	33.6529	-83.7237
231	240590	1950-1959	Not Eligible	33.6640	-83.7136
234	240609	1955-1964	Not Eligible	33.6652	-83.7131
235	240610	1955-1964	Not Eligible	33.6657	-83.7125
237	240612	1955-1964	Not Eligible	33.6686	-83.7105
241	*240621*	*1960-1969*	*Potentially Eligible*	*33.6704*	*-83.7094*
244	240624	1945-1954	Not Eligible	33.6728	-83.7088
245	240625	1945-1954	Not Eligible	33.6734	-83.7087
247	240627	1955-1964	Not Eligible	33.6765	-83.7082
248	240628	1965-1974	Not Eligible	33.6745	-83.7085
253	240615	1960-1969	Not Eligible	33.6557	-83.7118

Table 1. Identified Mid-century Resources

SC-ID	GNAHRGIS ID	Age	NRHP Eligibility	Latitude	Longitude
254	240629	1960-1969	Not Eligible	33.6561	-83.7124
255	240630	1955-1969	Not Eligible	33.6562	-83.7124
256	240631	1965-1974	Not Eligible	33.6563	-83.7126
257	*240635*	*1955-1964*	*Potentially Eligible*	*33.6563*	*-83.7126*
258	240637	1960-1969	Not Eligible	33.6563	-83.7125
259	240639	1960-1969	Not Eligible	33.6575	-83.7122
262	240644	1960-1969	Not Eligible	33.6539	-83.7109
263	240645	1960-1969	Not Eligible	33.6557	-83.7108
264	240646	1965-1974	Not Eligible	33.6563	-83.7112
265	240647	1960-1969	Not Eligible	33.6567	-83.7115
266	240648	1960-1969	Not Eligible	33.6570	-83.7117
267	*240649*	*1960-1969*	*Potentially Eligible*	*33.6572*	*-83.7118*
269	240468	1965-1974	Not Eligible	33.6742	-83.7086
270	240469	1960-1969	Not Eligible	33.6735	-83.7088
271	*240915*	*1965-1974*	*Potentially Eligible*	*33.6677*	*-83.7177*
272	240470	1960-1969	Not Eligible	33.6579	-83.7113
273	*240471*	*1960-1969*	*Potentially Eligible*	*33.6577*	*-83.7119*
274	*240472*	*1960-1969*	*Potentially Eligible*	*33.6574*	*-83.7110*
275	240473	1960-1969	Not Eligible	33.6577	-83.7112
276	*240474*	*1960-1969*	*Potentially Eligible*	*33.6580*	*-83.8374*
277	240475	1960-1969	Not Eligible	33.6580	-83.8374
279	240477	1970-1979	Not Eligible	33.6571	-83.7142
280	240479	1960-1969	Not listed	33.6576	-83.7174
283	240916	1950-1959	Not Eligible	33.6663	-83.7168
284	240917	1955-1964	Not Eligible	33.6657	-83.7173
285	240919	1950-1960	Not Eligible	33.6646	-83.7169
286	240920	1945-1954	Not Eligible	33.6646	-83.7169
288	240913	1960-1969	Not Eligible	33.6593	-83.7137
291	240922	1970	Not Eligible	33.6530	-83.7165
295	240926	1960	Not Eligible	33.6531	-83.7159
296	240927	1965	Not Eligible	33.6531	-83.7155
297	240928	1965	Not Eligible	33.6532	-83.7153
298	240929	1975	Not Eligible	33.6532	-83.7150
299	240930	1965	Not Eligible	33.6518	-83.7137
304	240329	1950	Not Eligible	33.6584	-83.7169
321	240931	1960-1969	Not Eligible	33.6520	-83.7140
324	240558	1965-1974	Not Eligible	33.6782	-83.7089
325	*240559*	*1965*	*Potentially Eligible*	*33.6719*	*-83.7090*
329	240593	1945-1954	Not Eligible	33.6700	-83.7096
330	240595	1965-1974	Not Eligible	33.6679	-83.7095
332	240597	1950-1959	Not Eligible	33.6667	-83.7117
334	240598	1950-1959	Not Eligible	33.6655	-83.7104
345	240431	1965-1974	Not Eligible	33.6556	-83.7249
354	*240589*	*1950-1959*	*Potentially Eligible*	*33.6638*	*-83.7537*
358	242525	1955-1964	Not Eligible	33.6579	-83.7203

Table 1. Identified Mid-century Resources


MID CENTURY
AGE DISTRIBUTION %

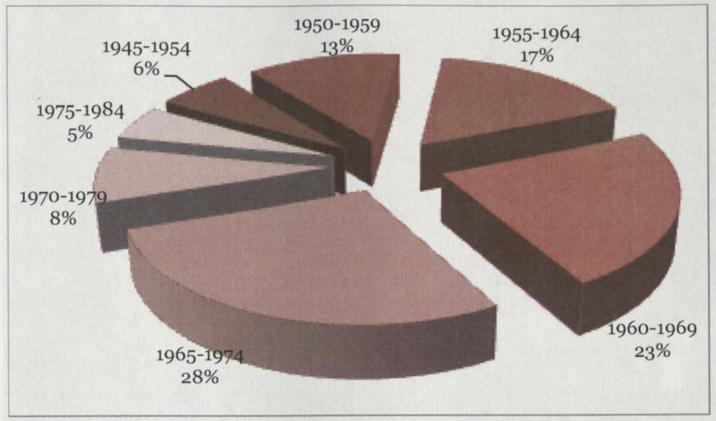

Age	Percent
1945-1954	6%
1950-1959	13%
1955-1964	17%
1960-1969	23%
1965-1974	28%
1970-1979	8%
1975-1984	5%

Table 2. Mid-Century Resources Age Distribution

MID CENTURY
AGE DISTRIBUTION

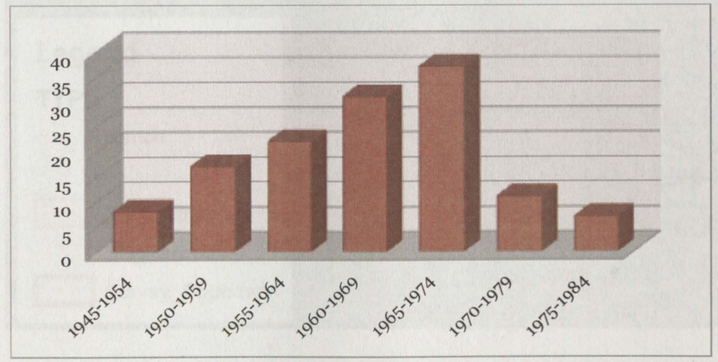

Age	Resources
1945-1954	8
1950-1959	17
1955-1964	22
1960-1969	31
1965-1974	37
1970-1979	11
1975-1984	7

Table 3. Mid-Century Resources Age Distribution by Percent

MID CENTURY
USE

Use	Count
Commercial Single Retail	4
Educational: School	2
Funerary	1
Governemental	1
Religious: Church	2
Multifamily Dwelling	1
Single Family Dwelling	120
Vacant	2

Table 4. Mid-Century Resources Use


MID CENTURY
HOUSE TYPE

House Type	Count
American Small House	9
Cross Gable Bungalow	3
Front Gable Bungalow	2
Hipped Bungalow	1
Side Gable Bungalow	7
Georgian House	2
Ranch House	100

Table 5. Mid-Century Resources House Types

Figure 2. Identified Ranch Hosues in Social Circle



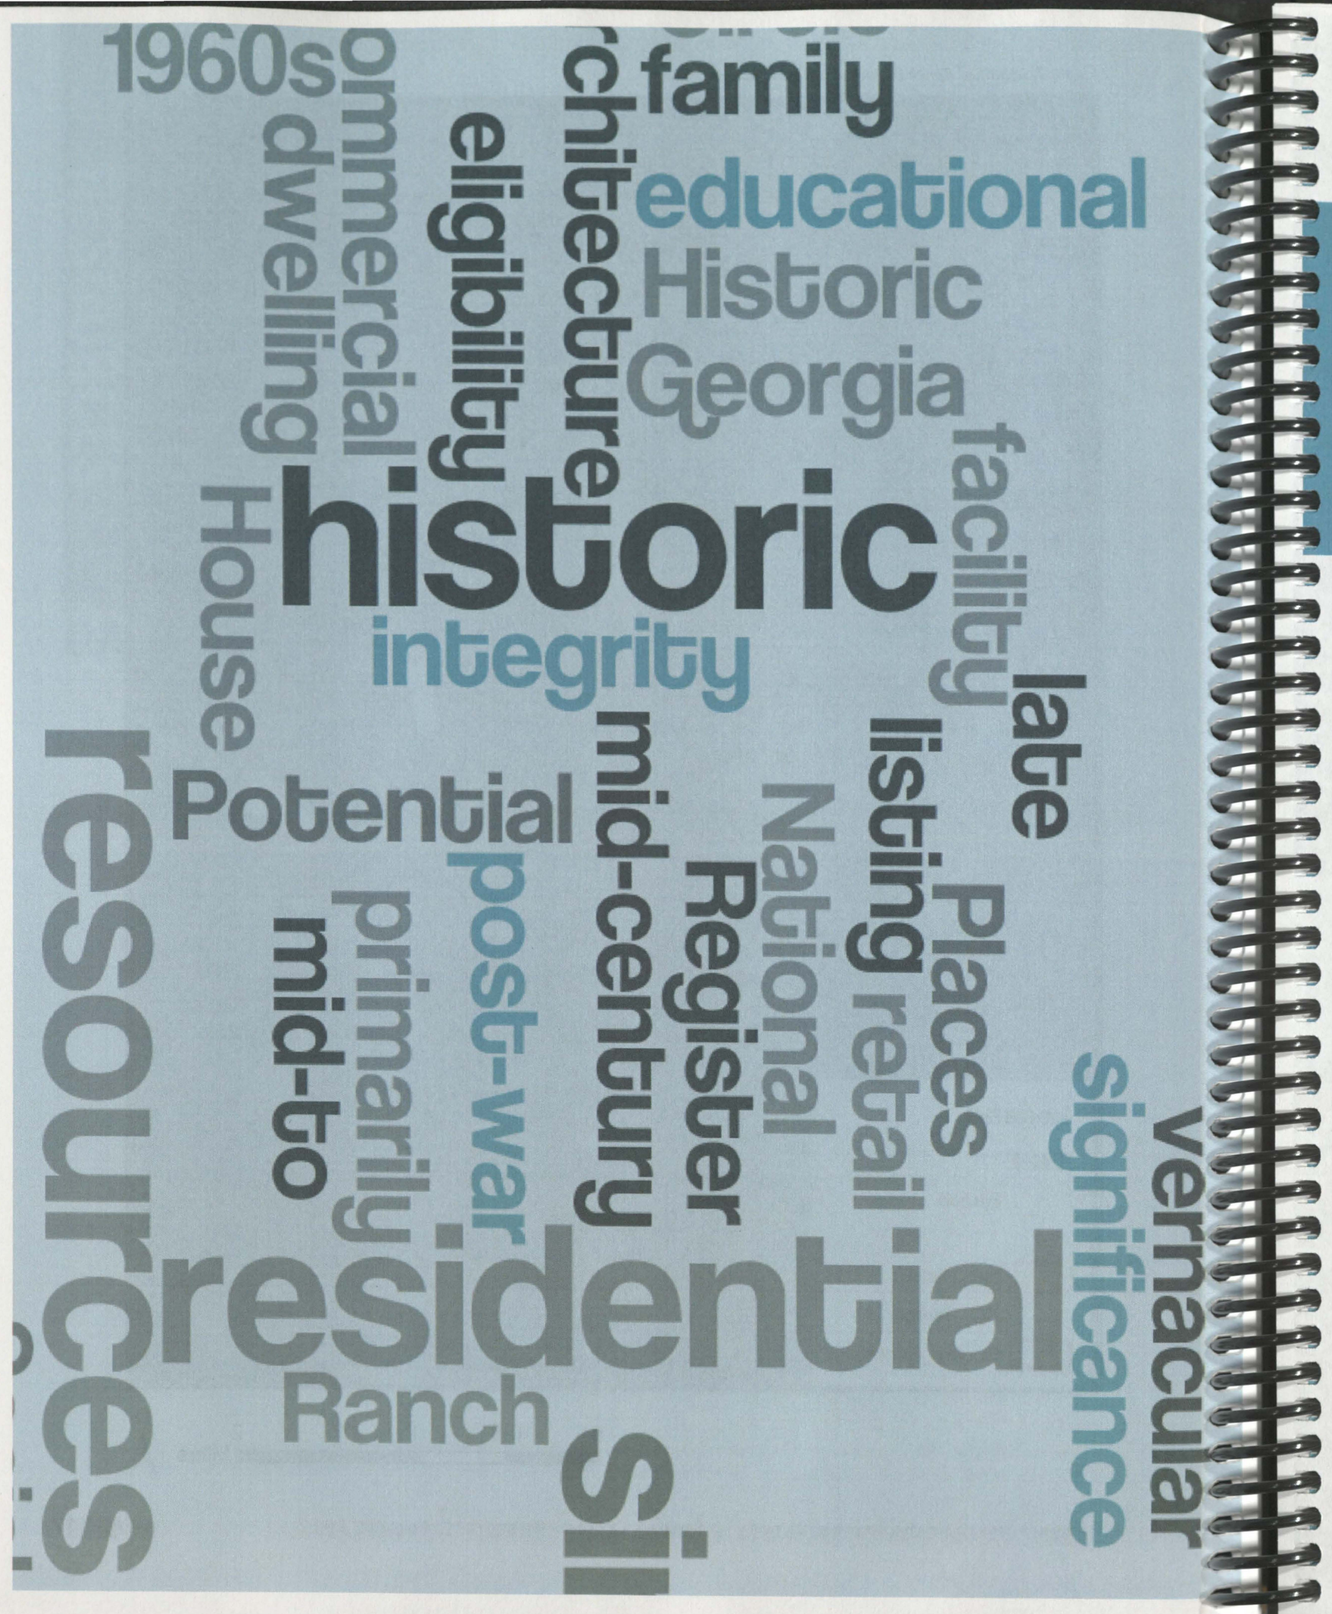

MID CENTURY
Resources Survey Results


A total of 133 historic resources constructed between 1945 and 1984 are extant in the City of Social Circle. These resources are primarily residential in use (90%), and overwhelmingly, the identified type was the Ranch House (81%). Many instances of Ranch House structures exist where the primary use has changed from single family dwelling to single retail commercial: SC-70, SC-166, SC-171, SC-306, SC-322, and SC-327. One resource, SC-32 is a Ranch House which has been converted into an educational facility. Most of the post-war resources dated to the mid-to late 1960s, with 68 resources constructed during this time period. 97% of the identified resources have no academic style, which is characteristic of mid-century vernacular residential architecture in Georgia.

Of the 133 surveyed resources, 15 are potentially eligible for listing in the National Register for Historic Places. Potential eligibility indicates that these structures meet the minimum criteria for integrity; location, design, setting, materials, workmanship, feeling and association; and historic significance, but may not have met the minimum age requirement. Further research as to the exact construction date and any association with an important person or event is warranted. Overall, few mid-century resources have excellent integrity; most have undergone changes in materials or footprint. These alterations adversely affect the architectural integrity of the resource and diminish the individual resource's historic significance. Modifications such as enclosed carports or altered porches, paint covering natural brick and patterned stone or altered roof design are considered to seriously compromise a mid-century resource's integrity.[1]

[1] Richard Cloues. The Ranch House in Georgia: Guidelines for Evaluation. Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 94.





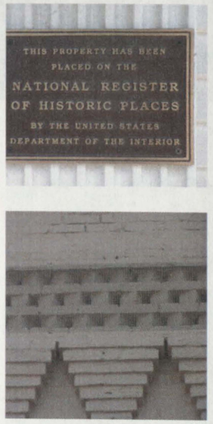











Survey Results

In addition to identifying mid-century resources, the survey team reexamined those resources documented in the 2002-2003 HPD survey of Social Circle. The additional survey documented the current architectural integrity of the existing Social Circle Historic District and surrounding areas in order to place post war structures in a historic context. The Social Circle Historic District is comprised of residential, commercial, and industrial structures, including the historic downtown, and date to the turn of the 20th century.

A total of 370 resources were documented that meet maintain a minimum level of age, integrity, and significance. The construction date of all identified resources range from the mid-1840s to the mid-1980s; the period with the most extant resources is from 1955-1974 with 53 (14%), followed by 1900-1914 with 43 (12%). The variance in building type and architectural styles exhibited throughout Social Circle is typical for 19th century towns located along railroads. The majority of identified resources are single family dwellings (83%), with the most common types being the Ranch House (31%) and the Saddlebag (8.7%). The majority of all resources (65.6%) did not exhibit any type of High Style architecture, and are consider to be of no academic style.

Owens Library
College of Environment & Design
University of Georgia


Figure 6. All Identified Resources within Social Circle, GA



Figure 7. All Identified Resources by Date



Figure 8. National Register for Historic Places Eligibility of Resources

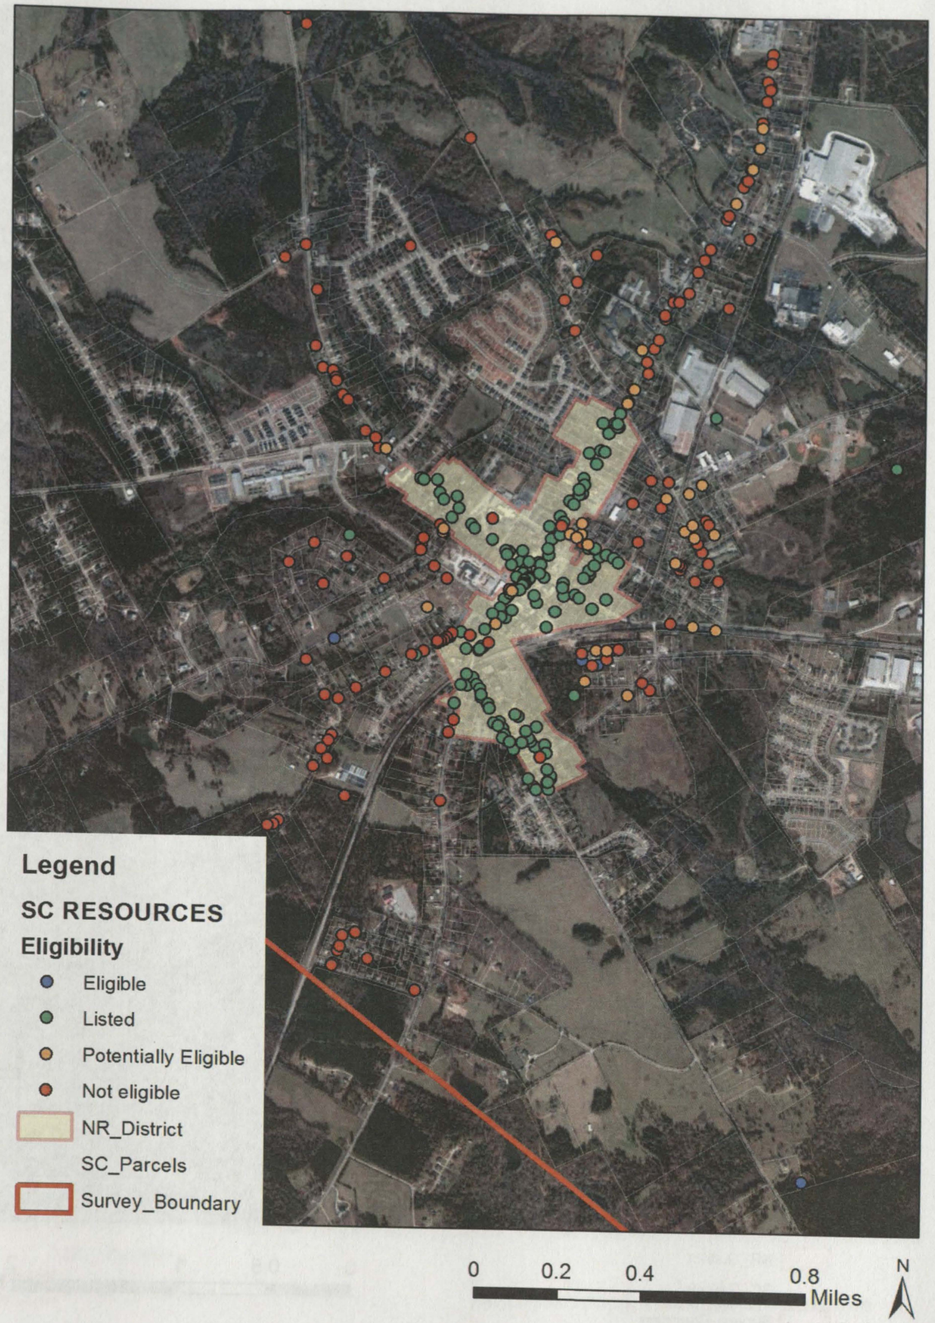

ALL IDENTIFIED RESOURCES DATA

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-1	Willow Spring Church Road Cemetery	Eligible	240247
SC-2	**Saddlebag: 2 Door**	**Listed**	**240250**
SC-3	**Saddlebag: 2 Door**	**Listed**	**240254**
SC-4	**Double Shotgun**	**Listed**	**240257**
SC-5	**Double Shotgun**	**Listed**	**240258**
SC-6	**Double Pen**	**Listed**	**240263**
SC-7	**Hipped Bungalow**	**Listed**	**240264**
SC-8	**Saddlebag: 2 Door**	**Listed**	**240266**
SC-9	**Saddlebag: 2 Door**	**Listed**	**240267**
SC-10	**Saddlebag: 2 Door**	**Listed**	**240269**
SC-11	**Saddlebag: 2 Door**	**Listed**	**240273**
SC-12	**Saddlebag: 2 Door**	**Listed**	**240276**
SC-13	**Central Hallway Cottage**	**Listed**	**240277**
SC-14	**Saddlebag: 2 Door**	**Listed**	**240301**
SC-15	**Saddlebag: 2 Door**	**Listed**	**240302**
SC-16	**Saddlebag: 2 Door**	**Listed**	**240303**
SC-17	**Saddlebag: 2 Door**	**Listed**	**240304**
SC-18	**Saddlebag: 2 Door**	**Listed**	**240305**
SC-19	**Saddlebag: 2 Door**	**Listed**	**240306**
SC-20	**Saddlebag: 2 Door**	**Listed**	**240308**
SC-21	**Saddlebag: 2 Door**	**Listed**	**240309**
SC-22	**Saddlebag: 2 Door**	**Listed**	**240310**
SC-23	**Saddlebag: 2 Door**	**Listed**	**240312**
SC-24	**Double Pen**	**Listed**	**240313**
SC-25	**Hall-parlor**	**Listed**	**240314**
SC-26	**Gabled Ell Cottage**	**Listed**	**240315**
SC-27	**Saddlebag: 2 Door**	**Listed**	**240317**
SC-28	Cross Gable Bungalow	Not Eligible	240249
SC-29	New South Cottage	Not Eligible	240251
SC-30	Ranch House	Not Eligible	240253
SC-31	American Small House	Not Eligible	240255
SC-32	Ranch House	Not Eligible	240256
SC-33	Queen Anne Cottage	Not Eligible	240259
SC-34	Georgian Cottage	Not Eligible	240260
SC-35	Georgian Cottage	Not Eligible	240261
SC-36	Georgian Cottage	Not Eligible	240290
SC-37	**Gabled Ell Cottage**	**Listed**	**240291**
SC-38	**Gabled Ell Cottage**	**Listed**	**240292**
SC-39	**Shotgun**	**Listed**	**240278**
SC-40	**Hall-parlor**	**Listed**	**240279**
SC-41	**Saddlebag: 2 Door**	**Listed**	**240280**
SC-42	**Saddlebag: 2 Door**	**Listed**	**240281**
SC-43	**Saddlebag: unknown**	**Listed**	**240282**
SC-44	**Hall-parlor**	**Listed**	**240283**

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-45	**Saddlebag: 2 Door**	**Listed**	**240284**
SC-46	**Hipped Bungalow**	**Listed**	**240285**
SC-47	**Cemetery**	**Listed**	**240286**
SC-48	Ranch House	Potentially Eligible	240287
SC-49	Ranch House	Potentially Eligible	240288
SC-50	**Central Hallway Cottage**	**Listed**	**240289**
SC-51	Ranch House	Not Eligible	240898
SC-52	Georgian House	Not Eligible	64935
SC-53	Ranch House	Not Eligible	240311
SC-54	**Saddlebag: 2 Door**	**Listed**	**241005**
SC-55	Hall-parlor	Not Eligible	241002
SC-56	Saddlebag: 2 Door	Not Eligible	65119
SC-57	Georgian Cottage	Potentially Eligible	240316
SC-58	Pyramid Cottage	Not Eligible	240318
SC-59	Other	Not Eligible	240358
SC-60	Ranch House	Not Eligible	240904
SC-61	Cross Gable Bungalow	Not Eligible	240359
SC-62	Ranch House	Not Eligible	240361
SC-63	New South Cottage	Not Eligible	240362
SC-64	Front Gable Bungalow	Not Eligible	240363
SC-65	Side Gable Bungalow	Not Eligible	240905
SC-66	Side Gable Bungalow	Potentially Eligible	240906
SC-67	Ranch House	Not Eligible	240907
SC-68	Ranch House	Not Eligible	240448
SC-69	Ranch House	Not Eligible	240449
SC-70	Ranch House	Not Eligible	240450
SC-71	Connor Family Cemetery	Potentially Eligible	240451
SC-72	Ranch House	Potentially Eligible	240454
SC-73	Ranch House	Not Eligible	240455
SC-74	**Front Gable Bungalow**	**Listed**	**65144**
SC-75	**Mars Hill Baptist Church**	**Listed**	**240616**
SC-76	**Gabled Ell Cottage**	**Listed**	**240617**
SC-77	**Georgian House**	**Listed**	**240656**
SC-78	**Georgian House**	**Listed**	**240662**
SC-79	**Georgian House**	**Listed**	**240665**
SC-80	**Queen Anne House**	**Listed**	**240668**
SC-81	**Queen Anne Cottage**	**Listed**	**240669**
SC-82	**Hall-parlor**	**Listed**	**240685**
SC-83	**English Cottage**	**Listed**	**240686**
SC-84	**English Cottage**	**Listed**	**240687**
SC-85	Side Gable Bungalow	Potentially Eligible	240270
SC-86	Side Gable Bungalow	Not Eligible	240271
SC-87	New South Cottage	Potentially Eligible	64924
SC-88	Duplex	Not Eligible	240272

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-89	Ranch House	Not Eligible	240274
SC-90	Central Hallway Cottage	Not Eligible	240275
SC-91	**American Small House**	**Listed**	**240908**
SC-92	**Single Retail Commercial Structure**	**Listed**	**64933**
SC-93	Single Retail Commercial Structure	Not Eligible	240909
SC-94	**Multiple Retail Commercial Block**	**Listed**	**64932**
SC-95	**Multiple Retail Commercial Block**	**Listed**	**64931**
SC-96	**Multiple Retail Commercial Block**	**Listed**	**64930**
SC-97	**Single Retail Commercial Structure**	**Listed**	**64929**
SC-98	**Multiple Retail Commercial Block**	**Listed**	**64928**
SC-99	**Multiple Retail Commercial Block**	**Listed**	**64927**
SC-100	**Multiple Retail Commercial Block**	**Listed**	**240371**
SC-101	**Multiple Retail Commercial Block**	**Listed**	**64926**
SC-102	Circle View Cemetery	Potentially Eligible	240372
SC-103	Ranch House	Not Eligible	240910
SC-104	**Queen Anne House**	**Listed**	**241004**
SC-105	Georgian House	Potentially Eligible	65143
SC-106	Ranch House	Not Eligible	240911
SC-107	**Ranch House**	**Listed**	**240432**
SC-108	**Saddlebag: 2 Door**	**Listed**	**64939**
SC-109	Ranch House	Not Eligible	240433
SC-110	Ranch House	Not Eligible	240434
SC-111	Ranch House	Not Eligible	240435
SC-112	Side Gable Bungalow	Not Eligible	240436
SC-113	New South Cottage	Not Eligible	64962
SC-114	Hipped Bungalow	Not Eligible	240437
SC-115	**Unknown**	**Listed**	**240457**
SC-116	**Georgian Cottage**	**Listed**	**240460**
SC-117	**Georgian House**	**Listed**	**240462**
SC-118	**Queen Anne Cottage**	**Listed**	**240464**
SC-119	**Side Gable Bungalow**	**Listed**	**240935**
SC-120	**New South Cottage**	**Listed**	**240466**
SC-121	**Cross Gable Bungalow**	**Listed**	**65154**
SC-122	**Queen Anne Cottage**	**Listed**	**240467**
SC-123	Side Gable Bungalow	Not Eligible	240378
SC-124	Front Gable Bungalow	Not Eligible	240380
SC-125	American Small House	Not Eligible	240382
SC-126	Ranch House	Not Eligible	240944
SC-127	Ranch House	Not Eligible	240385
SC-128	Hipped Bungalow	Not Eligible	240393
SC-129	Gabled Ell Cottage	Not Eligible	240395
SC-130	Ranch House	Not Eligible	240397
SC-131	Ranch House	Not Eligible	240398
SC-132	Ranch House	Not Eligible	240401

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-133	Ranch House	Not Eligible	240402
SC-134	Ranch House	Not Eligible	240403
SC-135	Ranch House	Not Eligible	240404
SC-136	Ranch House	Not Eligible	240405
SC-137	Ranch House	Not Eligible	240406
SC-138	Ranch House	Not Eligible	240407
SC-139	Ranch House	Not Eligible	240408
SC-140	Ranch House	Not Eligible	204409
SC-141	Ranch House	Not Eligible	240410
SC-142	Ranch House	Not Eligible	240412
SC-143	Ranch House	Not Eligible	240413
SC-144	**Georgian House**	**Listed**	**64952**
SC-145	Queen Anne Cottage	Potentially Eligible	240414
SC-146	Commercial: Motel	Not Eligible	240415
SC-147	**Social Circle United Methodist**	**Listed**	**240416**
SC-148	Gas Station	Not Eligible	240424
SC-149	Ranch House	Not Eligible	240425
SC-150	Ranch House	Not Eligible	240426
SC-151	Ranch House	Not Eligible	240427
SC-152	Ranch House	Not Eligible	240428
SC-153	Georgian House	Not Eligible	240429
SC-154	Georgian House	Not Eligible	240230
SC-155	Ranch House	Not Eligible	240438
SC-156	Ranch House	Not Eligible	240439
SC-157	Ranch House	Not Eligible	240440
SC-158	Ranch House	Not Eligible	240441
SC-159	**English Cottage**	**Listed**	**240442**
SC-160	**Georgian House**	**Listed**	**65153**
SC-161	**Queen Anne Cottage**	**Listed**	**65155**
SC-162	Cross Gable Bungalow	Not Eligible	240982
SC-163	**Queen Anne Cottage**	**Listed**	**65161**
SC-164	Gas Station	Not Eligible	240245
SC-165	**Georgian House**	**Listed**	**240246**
SC-166	**Georgian Cottage**	**Listed**	**240248**
SC-167	**Double Tower Church**	**Listed**	**240252**
SC-168	**Georgian Cottage**	**Listed**	**65131**
SC-169	**English Cottage**	**Listed**	**65132**
SC-170	**New South Cottage**	**Listed**	**65133**
SC-171	**Georgian House**	**Listed**	**65134**
SC-172	Georgian Cottage	Potentially Eligible	240262
SC-173	**Side Gable Bungalow**	**Listed**	**65139**
SC-174	**Georgian House**	**Listed**	**65138**
SC-175	**Georgian House**	**Listed**	**240265**
SC-176	**Gabled Ell Cottage**	**Listed**	**65136**

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-177	**Queen Anne Cottage**	**Listed**	**65135**
SC-178	Saddlebag: Central Door	Not Eligible	240268
SC-179	Central Hallway Cottage	Potentially Eligible	65117
SC-180	**Shotgun**	**Listed**	**240379**
SC-181	Single Retail Commercial Structure	Not Eligible	240381
SC-182	**New South Cottage**	**Listed**	**240383**
SC-183	**Great Walton Railroad Office**	**Listed**	**240386**
SC-184	Single Retail Commercial Structure	Not Eligible	240387
SC-185	**Queen Anne Cottage**	**Listed**	**240390**
SC-186	**Georgian Cottage**	**Listed**	**240391**
SC-187	Gabled Ell Cottage	Not Eligible	240392
SC-188	**Gabled Ell Cottage**	**Listed**	**240394**
SC-189	Cross Gable Bungalow	Potentially Eligible	240396
SC-190	Queen Anne Cottage	Potentially Eligible	240399
SC-191	Ranch House	Not Eligible	240912
SC-192	American Small House	Potentially Eligible	240400
SC-193	Ranch House	Potentially Eligible	240417
SC-194	Side Gable Bungalow	Not Eligible	240418
SC-195	Central Hallway Cottage	Potentially Eligible	240419
SC-196	**Georgian cottage**	**Listed**	**240420**
SC-197	**Georgian Cottage**	**Listed**	**240421**
SC-198	**Cross Gable Bungalow**	**Listed**	**240422**
SC-199	**Central Hallway Cottage**	**Listed**	**240423**
SC-200	Queen Anne Cottage	Potentially Eligible	240502
SC-201	Front Gable Bungalow	Not Eligible	240503
SC-202	New South Cottage	Not Eligible	64934
SC-203	Ranch House	Not Eligible	240504
SC-204	Ranch House	Not Eligible	240505
SC-205	Side Gable Bungalow	Not Eligible	240518
SC-206	Ranch House	Not Eligible	240519
SC-207	Ranch House	Not Eligible	240521
SC-208	Ranch House	Not Eligible	240522
SC-209	Ranch House	Not Eligible	240523
SC-210	Ranch House	Not Eligible	240524
SC-211	Ranch House	Not Eligible	240525
SC-212	Ranch House	Not Eligible	240527
SC-213	Cemetery	Not Eligible	240536
SC-214	Front Gable Bungalow	Not Eligible	240538
SC-215	Front Gable Bungalow	Not Eligible	240540
SC-216	Front Gable Bungalow	Not Eligible	240542
SC-217	Front Gable Bungalow	Not Eligible	240545
SC-218	Front Gable Bungalow	Not Eligible	240549
SC-219	Front Gable Bungalow	Not Eligible	240564
SC-220	American Small House	Not Eligible	240550

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-221	Ranch House	Not Eligible	240562
SC-222	**Multiple Retail Commercial Block**	**Listed**	**240567**
SC-223	**Multiple Retail Commercial Block**	**Listed**	**65145**
SC-224	**Multiple Retail Commercial Block**	**Listed**	**240584**
SC-225	**Multiple Retail Commercial Block**	**Listed**	**240585**
SC-226	**Multiple Retail Commercial Block**	**Listed**	**240586**
SC-227	**Multiple Retail Commercial Block**	**Listed**	**240587**
SC-228	**Multiple Retail Commercial Block**	**Listed**	**65148**
SC-229	American Small House	Not Eligible	240588
SC-230	**Cross Gable Bungalow**	**Listed**	**240377**
SC-231	Side Gable Bungalow	Not Eligible	240590
SC-232	double pen	Not Eligible	240591
SC-233	Cross Gable Bungalow	Not Eligible	240607
SC-234	Ranch House	Not Eligible	240609
SC-235	Ranch House	Not Eligible	240610
SC-236	American Small House	Not Eligible	240611
SC-237	Ranch House	Not Eligible	240612
SC-238	Cross Gable Bungalow	Not Eligible	240618
SC-239	Gabled Ell Cottage	Potentially Eligible	240619
SC-240	Side Gable Bungalow	Not Eligible	240620
SC-241	Ranch House	Potentially Eligible	240621
SC-242	Georgian cottage	Not Eligible	240623
SC-243	Front Gable Bungalow	Not Eligible	240622
SC-244	American Small House	Not Eligible	240624
SC-245	American Small House	Not Eligible	240625
SC-246	**Cross Gable Bungalow**	**Listed**	**65159**
SC-247	Ranch House	Not Eligible	240627
SC-248	Ranch House	Not Eligible	240628
SC-249	**Queen Anne Cottage**	**Listed**	**65168**
SC-250	**Side Gable Bungalow**	**Listed**	**240608**
SC-251	**Gabled Ell Cottage**	**Listed**	**240613**
SC-252	**Gabled Ell Cottage**	**Listed**	**240614**
SC-253	Ranch House	Not Eligible	240615
SC-254	Ranch House	Not Eligible	240629
SC-255	Ranch House	Not Eligible	240630
SC-256	Ranch House	Not Eligible	240631
SC-257	Ranch House	Potentially Eligible	240635
SC-258	Ranch House	Not Eligible	240637
SC-259	Ranch House	Not Eligible	240639
SC-260	Hipped Bungalow	Not Eligible	240641
SC-261	Gabled Ell Cottage	Potentially Eligible	240642
SC-262	Ranch House	Not Eligible	240644
SC-263	Ranch House	Not Eligible	240645
SC-264	Ranch House	Not Eligible	240646

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-265	Ranch House	Not Eligible	240647
SC-266	Ranch House	Not Eligible	240648
SC-267	Ranch House	Potentially Eligible	240649
SC-268	Cemetery	Eligible	240663
SC-269	Ranch House	Not Eligible	240468
SC-270	American Small House	Not Eligible	240469
SC-271	Ranch House	Potentially Eligible	240915
SC-272	Ranch House	Not Eligible	240470
SC-273	Ranch House	Potentially Eligible	240471
SC-274	Ranch House	Potentially Eligible	240472
SC-275	Ranch House	Not Eligible	240473
SC-276	Ranch House	Potentially Eligible	240474
SC-277	Ranch House	Not Eligible	240475
SC-278	**Side Gable Bungalow**	**Listed**	**240376**
SC-279	Ranch House	Not Eligible	240477
SC-280	Ranch House	Not Eligible	240479
SC-281	Side Gable Bungalow	Potentially Eligible	65098
SC-282	Gabled Ell Cottage	Not Eligible	240481
SC-283	Side Gable Bungalow	Not Eligible	240916
SC-284	Side Gable Bungalow	Not Eligible	240917
SC-285	Ranch House	Not Eligible	240919
SC-286	Front Gable Bungalow	Not Eligible	240920
SC-287	Central Hallway Cottage	Not Eligible	240921
SC-288	Ranch House	Not Eligible	240913
SC-289	Front Gable Bungalow	Not Eligible	240914
SC-290	Single Pen	Eligible	240918
SC-291	Ranch House	Not Eligible	240922
SC-292	Single Pen	Not Eligible	240923
SC-293	Single Pen	Eligible	240924
SC-294	Single Pen	Not Eligible	240925
SC-295	Ranch House	Not Eligible	240926
SC-296	Ranch House	Not Eligible	240927
SC-297	Ranch House	Not Eligible	240928
SC-298	Ranch House	Not Eligible	240929
SC-299	Ranch House	Not Eligible	240930
SC-300	**Queen Anne Cottage**	**Listed**	**65141**
SC-301	**Queen Anne House**	**Listed**	**240326**
SC-302	**Queen Anne Cottage**	**Listed**	**240327**
SC-303	**New South Cottage**	**Listed**	**240328**
SC-304	Ranch House	Not Eligible	240329
SC-305	**Georgian House**	**Listed**	**240330**
SC-306	**Georgian House**	**Listed**	**240344**
SC-307	**Cross Gable Bungalow**	**Listed**	**240336**
SC-308	**Side Gable Bungalow**	**Listed**	**240338**

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-309	**Queen Anne Cottage**	**Listed**	**240340**
SC-310	**Georgian House**	**Listed**	**240342**
SC-311	**Georgian Cottage**	**Listed**	**240343**
SC-312	**New South Cottage**	**Listed**	**240344**
SC-313	**Front Gable Bungalow**	**Listed**	**240347**
SC-314	**Cross Gable Bungalow**	**Listed**	**240348**
SC-315	**New South Cottage**	**Listed**	**240349**
SC-316	**New South Cottage**	**Listed**	**240350**
SC-317	Side Gable Bungalow	Not Eligible	240351
SC-318	Central Hallway Cottage	Potentially Eligible	240352
SC-319	Central Hallway Cottage	Potentially Eligible	240353
SC-320	Gabled Ell Cottage	Not Eligible	240950
SC-321	Ranch House	Not Eligible	240931
SC-322	**Single Retail Commercial Structure**	**Listed**	**240375**
SC-323	Side Gable Bungalow	Not Eligible	240557
SC-324	Ranch House	Not Eligible	240558
SC-325	Side Gable Bungalow	Potentially Eligible	240559
SC-326	American Small House	Potentially Eligible	240560
SC-327	Single Retail Commercial Structure	Not Eligible	240561
SC-328	Front Gable Bungalow	Not Eligible	240563
SC-329	Front Gable Bungalow	Not Eligible	240593
SC-330	Ranch House	Not Eligible	240595
SC-331	Gabled Ell Cottage	Not Eligible	65094
SC-332	Side Gable Bungalow	Not Eligible	240597
SC-333	English Cottage	Not Eligible	65095
SC-334	Ranch House	Not Eligible	240598
SC-335	**Multiple Retail Commercial Block**	**Listed**	**240599**
SC-336	**Multiple Retail Commercial Block**	**Listed**	**240600**
SC-337	**Multiple Retail Commercial Block**	**Listed**	**240601**
SC-338	**Multiple Retail Commercial Block**	**Listed**	**240602**
SC-339	**Multiple Retail Commercial Block**	**Listed**	**240603**
SC-340	**Multiple Retail Commercial Block**	**Listed**	**240604**
SC-341	**Multiple Retail Commercial Block**	**Listed**	**240605**
SC-342	**Multiple Retail Commercial Block**	**Listed**	**240932**
SC-343	**Multiple Retail Commercial Block**	**Listed**	**240606**
SC-344	**Multiple Retail Commercial Block**	**Listed**	**240933**
SC-345	Ranch House	Not Eligible	240431
SC-346	**Front Gable Bungalow**	**Listed**	**240354**
SC-347	**Front Gable Bungalow**	**Listed**	**240355**
SC-348	American Small House	Not Eligible	240356
SC-349	**Front Gable Bungalow**	**Listed**	**240357**
SC-350	**Front Gable Bungalow**	**Listed**	**240360**
SC-351	**Front Gable Bungalow**	**Listed**	**240373**
SC-352	**Georgian Cottage**	**Listed**	**240374**

Table 6. Field Survey Results, Description of all Identified Resources

Resource ID	Description	NRHP Recommendation	GNARHGIS ID
SC-353	**Cross Gable Bungalow**	**Listed**	**241007**
SC-354	Cross Gable Bungalow	Potentially Eligible	240589
SC-355	**Side Gable Bungalow**	**Listed**	**65128**
SC-356	**Side Gable Bungalow**	**Listed**	**242524**
SC-357	**Hipped Bungalow**	**Listed**	**65127**
SC-358	School building: multi-wing	Not Eligible	242525
SC-359	**Queen Anne Cottage**	**Listed**	**65144**
SC-360	**Queen Anne House**	**Listed**	**65125**
SC-361	**Queen Anne House**	**Listed**	**65124**
SC-362	**Side Hallway**	**Listed**	**65123**
SC-363	**Side Hallway**	**Listed**	**65122**
SC-364	**Queen Anne Cottage**	**Listed**	**242535**
SC-365	**Georgian Cottage**	**Listed**	**242536**
SC-366	**Side Gable Bungalow**	**Listed**	**242537**
SC-367	**Queen Anne Cottage**	**Listed**	**242538**
SC-368	**Saddlebag: 2 Door**	**Listed**	**242539**
SC-369	**Saddlebag: 2 Door**	**Listed**	**242540**
SC-370	**I-house**	**Listed**	**242541**

Table 6. Field Survey Results, Description of all Identified Resources

RESOURCES: USE

Use	#
Civic	1
Commercial: Single Retail	32
Educational: School	2
Funerary: Cemetery	7
Governmental: Post Office	1
Religious: Church	3
Residential: Multiple Family Dwelling	2
Residential: Single Family Dwelling	308
Transportation: Depot	1
Vacant	13


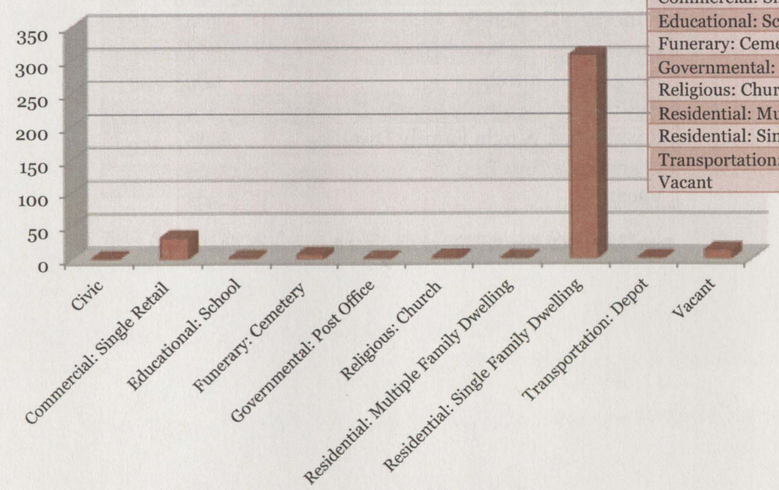


Table 7. Field Survey Results, All Identified Resources, Use

RESOURCES:
USE PERCENTAGES

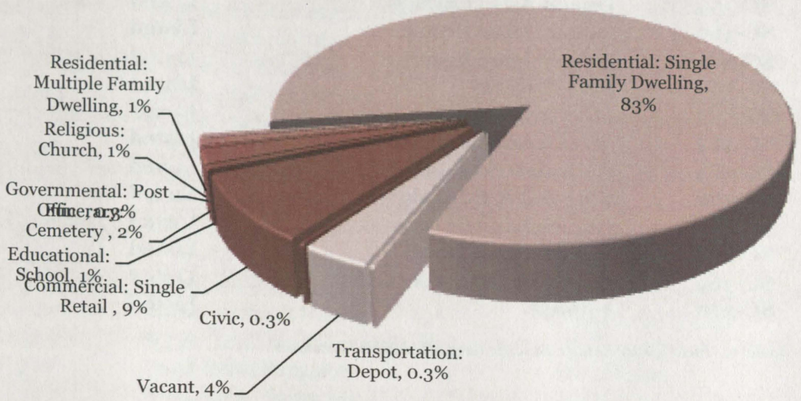

Use	%
Civic	0.3%
Commercial: Single Retail	9%
Educational: School	1%
Funerary: Cemetery	2%
Governmental: Post Office	0.3%
Religious: Church	1%
Residential: Multiple Family Dwelling	1%
Residential: Single Family Dwelling	83%
Transportation: Depot	0.3%
Vacant	4%

Table 8. Field Survey Results, All Identified Resources, Use Percentages

RESOURCES:
AGE DISTRIBUTION

Age	Count
1840-1849	2
1850-1859	1
1860-1869	3
1865-1874	1
1870-1879	3
1875-1884	1
1880-1889	8
1885-1894	10
1890-1899	9
1895-1904	5
1900-1909	25
1905-1914	18
1910-1919	73
1915-1924	8
1920-1929	19
1925-1934	12
1930-1939	22
1935-1944	7
1940-1949	10
1945-1954	8
1950-1959	17
1955-1964	22
1960-1969	31
1965-1974	37
1970-1979	11
1975-1984	7
	370


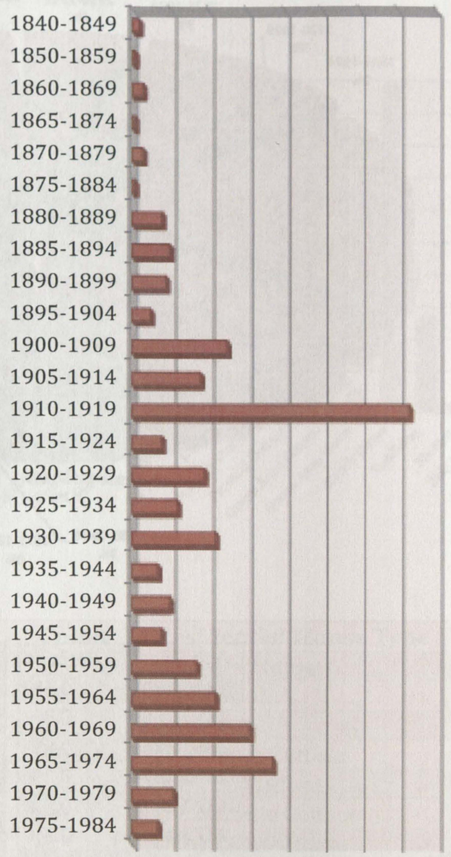


Table 9. Field Survey Results, All Identified Resources, Age Distribution

RESOURCES:
CONSTRUCTION DATE

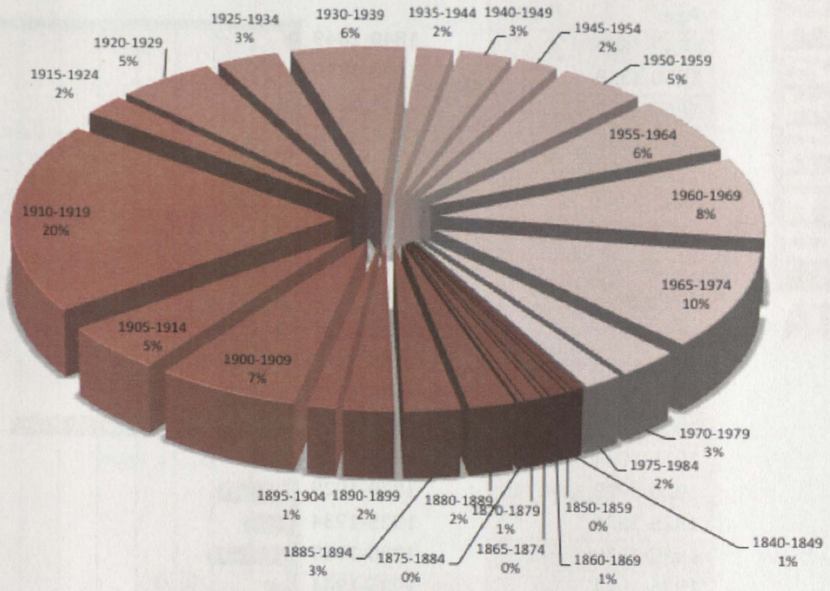


Age	Percent
1840-1849	0.5%
1850-1859	0.3%
1860-1869	0.8%
1865-1874	0.3%
1870-1879	0.8%
1875-1884	0.3%
1880-1889	2.2%
1885-1894	2.7%
1890-1899	2.4%
1895-1904	1.4%
1900-1909	6.8%
1905-1914	4.9%
1910-1919	19.7%

Age	Percent
1915-1924	2.2%
1920-1929	5.1%
1925-1934	3.2%
1930-1939	5.9%
1935-1944	1.9%
1940-1949	2.7%
1945-1954	2.2%
1950-1959	4.6%
1955-1964	5.9%
1960-1969	8.4%
1965-1974	10.0%
1970-1979	3.0%
1975-1984	1.9%

Table 10. Field Survey Results, All Identified Resources, Construction Date by Percentage

RESOURCES:
RESIDENTIAL BUILDING TYPES

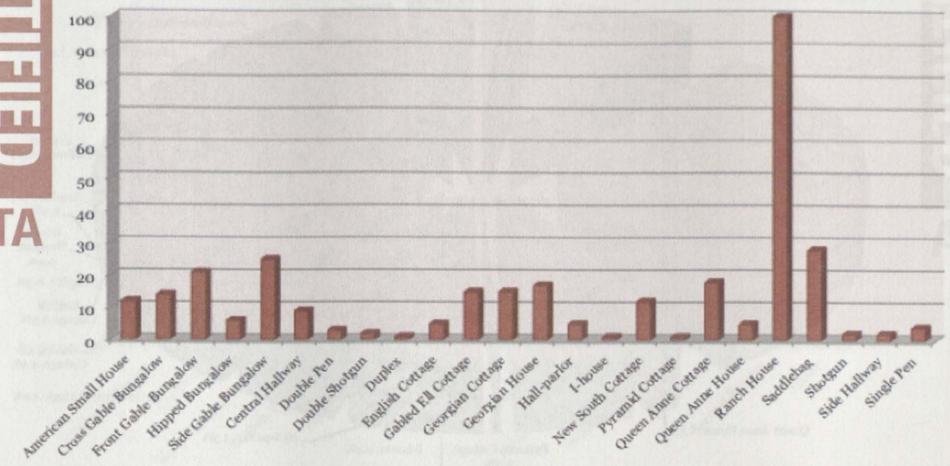


Residential House Type	Count
American Small House	12
Cross Gable Bungalow	14
Front Gable Bungalow	21
Hipped Bungalow	6
Side Gable Bungalow	25
Central Hallway	9
Double Pen	3
Double Shotgun	2
Duplex	1
English Cottage	5
Gabled Ell Cottage	15
Georgian Cottage	15

Residential House Type	Count
Georgian House	17
Hall-parlor	5
I-house	1
New South Cottage	12
Pyramid Cottage	1
Queen Anne Cottage	18
Queen Anne House	5
Ranch House	100
Saddlebag	28
Shotgun	2
Side Hallway	2
Single Pen	4
Total	323

Table 11. Field Survey Results, All Identified Resources, Residential Building Types

RESOURCES:
RESIDENTIAL BUILDING TYPE BY %

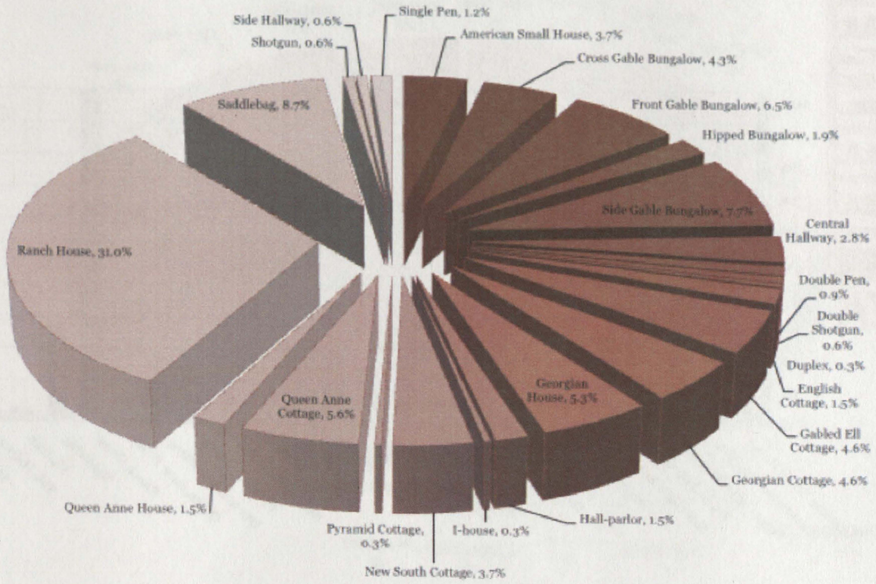


Residential House Type	Count
American Small House	3.7%
Cross Gable Bungalow	4.3%
Front Gable Bungalow	6.5%
Hipped Bungalow	1.9%
Side Gable Bungalow	7.7%
Central Hallway	2.8%
Double Pen	0.9%
Double Shotgun	0.6%
Duplex	0.3%
English Cottage	1.5%
Gabled Ell Cottage	4.6%
Georgian Cottage	4.6%

Residential House Type	Count
Georgian House	5.3%
Hall-parlor	1.5%
I-house	0.3%
New South Cottage	3.7%
Pyramid Cottage	0.3%
Queen Anne Cottage	5.6%
Queen Anne House	1.5%
Ranch House	31.0%
Saddlebag	8.7%
Shotgun	0.6%
Side Hallway	0.6%
Single Pen	1.2%

Table 12. Field Survey Results, All Identified Resources, Residential Building Type By Percentage


RESOURCES:
ARCHITECTURAL STYLES

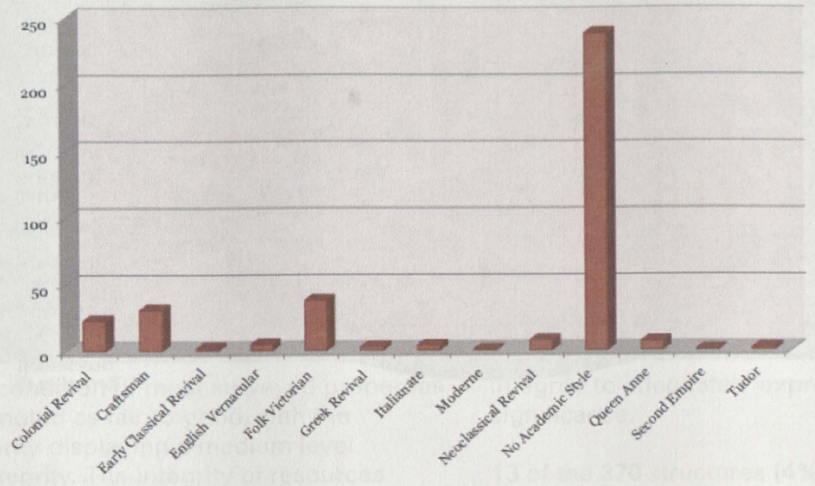

Style	Count
Colonial Revival	23
Craftsman	31
Early Classical Revival	2
English Vernacular	5
Folk Victorian	38
Greek Revival	3
Italianate	4
Moderne	1
Neoclassical Revival	8
No Academic Style	238
Queen Anne	7
Second Empire	1
Tudor	2

Table 13. Field Survey Results, All Identified Resources, Architectural Styles

RESOURCES:
ARCHITECTURAL STYLES BY %

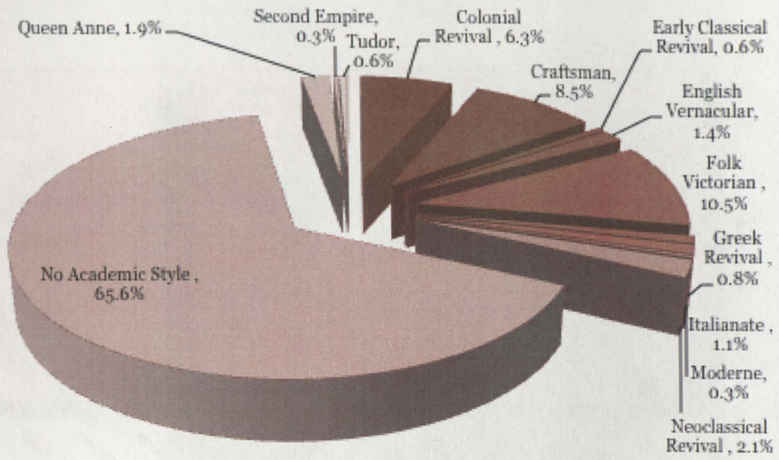

Style	Percent
Colonial Revival	6.3%
Craftsman	8.5%
Early Classical Revival	0.6%
English Vernacular	1.4%
Folk Victorian	10.5%
Greek Revival	0.8%
Italianate	1.1%
Moderne	0.3%
Neoclassical Revival	2.1%
No Academic Style	65.6%
Queen Anne	1.9%
Second Empire	0.3%
Tudor	0.6%

Table 14. Field Survey Results, All Identified Resources, Architectural Styles by Percentage

Integrity



The condition of most surveyed properties was noted as fair to good, with the majority displaying a medium level of integrity. The integrity of resources can be affected by major non-historic alterations. These changes include additions to the building and material replacements including but not limited to: exterior cladding, porch alterations, window or door replacements, etc. Routine maintenance such as roof repair or repointing was not considered when evaluating architectural integrity.

Resources designated within the Social Circle Historic District overall have maintained excellent architectural integrity. A few instances exist where alterations have diminished the overall integrity of the resource. These resources are noted as 'Not Eligible' for listing in the National Register for Historic Places;' however, they have not been delisted from the original district. The historic district maintains enough architectural integrity to adequately express its historic significance.

13 of the 370 structures (4%) surveyed are currently vacant. Vacant properties are considered highly endangered because they are more susceptible to fire and vandalism. Additionally, repairs and weatherproofing are not carried out in a timely manner, thus leaving structures to decay.

The existing Social Circle Historic District has 148 properties listed. Of the remaining resources, 8 are considered eligible but not listed within the district, and an additional 35 are potentially eligible for listing in the National Register. These resources were individually evaluated under the appropriate criteria and maintain good to excellent architectural integrity (Table 6).


















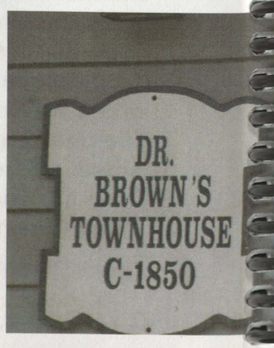

Conclusion

The City of Social Circle has done an excellent job maintaining the resources listed in its historic district. The number of intact mid-century resource which maintain high levels of architectural integrity express a period of significant growth in Georgia. The disparate locations of these resources however, do not suggest a future Ranch House historic district (Figure 2). Social Circle does not appear to suffer from extreme developmental pressures; the documented Ranch Houses are located in well established neighborhoods. Although few of the resources are potentially eligible for listing in the National Register, none appear to be the work of a significant architect, or possess elements of high style architecture or are exemplary illustrations of this house type.

Social Circle Historic Resource

Resource ID SC-01 Willow Spring Church Road Cem

Address 2107 Willow Spring Church Rd

County Walton



NARGHIS ID 240247

Resource Type	Site
Resource Use	Funerary : Cemetery
Date of Construction	1875
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	
Style	
Roof	
Exterior Cladding	
Foundation	
Porch	
Windows	
Chimney	
Alterations	

Preliminary Assessment	Status - Listed	Applicable Criteria
Eligible	Not Listed	C,D

Social Circle Historic Resource

Resource ID SC-02

Address 332 Cannon Dr

County Walton



NARGHIS ID 240250

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 Door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Brick: center
Alterations	Replacement windows, rear addition

Preliminary Assessment	Status - Listed	Applicable Criteria
Not eligible	Listed	C

Social Circle Historic Resource

Resource ID SC-03

Address 342 Cannon Dr

County Walton



NARGHIS ID 240254

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 Door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: Brick
Porch	Verandah
Windows	Double hung sash: 3/1, 9/1
Chimney	Center: Brick
Alterations	Replacement windows and door, rear addition

Preliminary Assessment	Status - Listed	Applicable Criteria
Eligible	Listed	C

Social Circle Historic Resource

Resource ID SC-04

Address 354 Cannon Dr

County Walton



NARGHIS ID 240257

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Double Shotgun
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: Front
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center: Brick
Alterations	Rear shed addition

Preliminary Assessment	Status - Listed	Applicable Criteria
Eligible	Listed	C

Social Circle Historic Resource

Resource ID SC-05
Address 450 Cedar St
County Walton



NARGHIS ID 240258

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Double Shotgun
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: Brick
Porch	Verandah
Windows	Double Hung Sash: 9/9
Chimney	Center: Brick
Alterations	Replacement porch supports, rear shed addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-06
Address 449 Cedar St
County Walton



NARGHIS ID 240263

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Double Pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Wood: Weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double Hung Sash: 6/6
Chimney	No Chimney Observed
Alterations	Integrated carport addition, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-07
Address 438 Cedar St
County Walton



NARGHIS ID 240264

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Bungalow: Hip
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: Brick
Porch	Verandah
Windows	Double Hung Sash: 9/9
Chimney	No chimney observed
Alterations	Side addition, enclosed verandah

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-08
Address 355 Cedar St
County Walton



NARGHIS ID 240266

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double Hung Sash: 6/6, 9/9
Chimney	Center: brick
Alterations	Multiple rear additions, mid-century awnings

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-09
Address 327 Cedar St
County Walton



NARGHIS ID 240267

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double Hung Sash: 9/9
Chimney	Center: brick
Alterations	Replacement door, porch supports; rear addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-10
Address 345 Cedar St
County Walton



NARGHIS ID 240269

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Synthetic Siding: Vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double Hung Sash: 2/2
Chimney	Center: brick
Alterations	Material replacements

Preliminary Assessment Not Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-11
Address 360 Cedar St
County Walton



NARGHIS ID 240273

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1919
House Type	Saddlebar: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Center ridgeline: brick
Alterations	Replacement materials, addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-12
Address 314 Cedar St
County Walton



NARGHIS ID 240276

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Center: brick
Alterations	Rear addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-13
Address 384 Cedar St
County Walton



NARGHIS ID 240277

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebar: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Center ridgeline: stuccoed masonry
Alterations	Replacement materials, addition

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-14
Address 294 Cedar St
County Walton



NARGHIS ID 240301

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1920
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: masonite
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Center: brick
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-15
Address 274 Cedar St
County Walton



NARGHIS ID 240302

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off center ridgeline: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-16
Address 269 Cedar St
County Walton



NARGHIS ID 240303

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Hall-parlor
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-17
Address 264 Cedar St
County Walton



NARGHIS ID 240304

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6, 2/2
Chimney	Center: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-18
Address 250 Cedar St
County Walton



NARGHIS ID 240305

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6, 9/9
Chimney	Center: stuccoed masonry
Alterations	Replacement materials, addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-19
Address 249 Cedar St
County Walton



NARGHIS ID 240306

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Center: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-20
Address 240 Cedar St
County Walton



NARGHIS ID 240308

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-21

Address 239 Cedar St

County Walton



NARGHIS ID 240309

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double Hung sash: 9/9
Chimney	Center: brick
Alterations	Replacement materials, rear addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-22

Address 224 Cannon Dr

County Walton



NARGHIS ID 240310

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: Side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Unknown
Porch	Verandah
Windows	Double Hung sash: 6/6
Chimney	Center: brick
Alterations	Replacement materials: door, siding, porch supports; rear addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-23

Address 214 Cannon Dr

County Walton



NARGHIS ID 240312

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Portico
Windows	Double hung sash: 9/9
Chimney	No chimney observed
Alterations	Replacement materials, addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-24

Address 232 Cannon Dr

County Walton



NARGHIS ID 240313

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Double pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Replacement materials, additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-25
Address 244 Cannon Dr
County Walton



NARGHIS ID 240314

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Hall-parlor
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double Hung sash: 9/9
Chimney	Off center ridgeline: brick
Alterations	Replacement siding; large gable rear addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-26
Address 258 Cannon Dr
County Walton



NARGHIS ID 240315

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Gabled ell Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Gable: cross
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double Hung sash: 1/1
Chimney	Off-center ridgeline: brick
Alterations	Replacement siding, non-historic additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-27
Address 300 Cannon St
County Walton



NARGHIS ID 240317

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: asbestos
Foundation	Pier with infill: brick
Porch	Recessed
Windows	Double-hung sash: 6/6
Chimney	Off-center within roof surface: brick
Alterations	Replacement windows, porch supports, siding, and door

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-28
Address 673 St Route 11 South
County Walton



NARGHIS ID 240249

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Brick: veneer, aluminum
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Replacement siding

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-29
Address 596 State Route 11 S
County Walton



NARGHIS ID 240251

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Complex
Exterior Cladding	Synthetic siding: asbestos
Foundation	Unknown
Porch	Stoop
Windows	Double-hung sash: 6/6
Chimney	Off-center within roof surface: brick
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-30
Address 635 State Route 11 S
County Walton



NARGHIS ID 240253

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: veneer, aluminum
Foundation	Continuous: concrete, brick veneer
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-31
Address 462 State Route 11 S
County Walton



NARGHIS ID 240255

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	American Small House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: multi
Exterior Cladding	Brick; Synthetic siding: vinyl
Foundation	Unkown
Porch	Recessed
Windows	Double-hung: 2/2
Chimney	Off center ridgeline: brick
Alterations	Side addition, replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-32 Gibbs Rainbow Daycare
Address 431 State Route 11 S
County Walton



NARGHIS ID 240256

Resource Type	Building
Resource Use	Educational: school
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Vertical Board, Brick
Foundation	Pier with infill: brick
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Side addition, enclosed carport

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-33
Address 417 State Route 11 S
County Walton



NARGHIS ID 240259

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Queen Anne Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian: elements
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	
Porch	Wrap-around
Windows	Double-hung sash: 1/1
Chimney	No chimney observed
Alterations	Replacement materials, addition

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-34
Address 434 State Route 11
County Walton



NARGHIS ID 240260

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian
Roof	Hip
Exterior Cladding	Wood: weatherboard, drop siding
Foundation	Pier with infill: brick
Porch	Wrap-around
Windows	Double hung sash: 6/6
Chimney	Off center within roof surface: brick
Alterations	Rear addition

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-35
Address 410 State Route 11
County Walton



NARGHIS ID 240261

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic siding: asbestos
Foundation	Unkown
Porch	Wrap-around
Windows	Double-hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials, rear addition

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-36
Address 392 State Route 11
County Walton



NARGHIS ID 240290

Resource Type	Building
Resource Use	Vacant
Date of Construction	1915-1924
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 4/4, 6/6
Chimney	Off center within roof surface
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-37

Address 364 South Cherokee Rd

County Walton



NARGHIS ID 240291

Resource Type	Building
Resource Use	Vacant
Date of Construction	1915-1924
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victoian: elements
Roof	Gable: cross
Exterior Cladding	Wood:weatherboard,drop siding
Foundation	Continuous: brick
Porch	Wrap-around
Windows	Double-hung sash: 2/2
Chimney	Off center ridgeline, within roof surf: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-38

Address 348 Laurel Dr

County Walton



NARGHIS ID 240292

Resource Type	Building
Resource Use	Residential: Multiple Dwelling: Duplex
Date of Construction	1910-1919
House Type	Original: Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off center ridgeline, within roof surf: brick
Alterations	Multiple additions

Preliminary Assessment
Eligible

Status - Listed
Listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-39

Address 156 Laurel Dr

County Walton

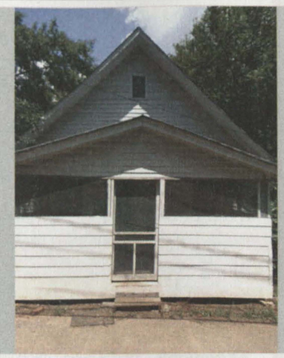

NARGHIS ID 240278

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Shotgun
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Lateral interior: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-40

Address 160 Laurel Dr

County Walton



NARGHIS ID 240279

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1915-1924
House Type	Hall-parlor
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Off-center within roof surface: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-41
Address 166 Laurel Dr
County Walton



NARGHIS ID 240280

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Replacement materials

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-42
Address 165 Laurel Dr
County Walton



NARGHIS ID 240281

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: asbestos
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surface: brick
Alterations	Replacement materials, addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-43
Address 174 Laurel Dr
County Walton



NARGHIS ID 240282

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: unknown
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6, 9/9
Chimney	Center ridgeline: brick
Alterations	Replacement materials, addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-44
Address 186 Laurel Dr
County Walton



NARGHIS ID 240283

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Hall-parlor
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: asbestos
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Replacement materials

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-45

Address 194 Laurel Dr

County Walton



NARGHIS ID 240284

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: unknown
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	No chimney observed
Alterations	Rear addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-46

Address 191 Laurel Dr

County Walton



NARGHIS ID 240285

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Bungalow: hip
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6, 1/1
Chimney	Center: brick
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-47

Address Corner of Leggett and Annie D Henderson

County Walton



NARGHIS ID 240286

Resource Type	Site
Resource Use	Funerary: Cemetery
Date of Construction	1937
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	
Style	
Roof	
Exterior Cladding	
Foundation	
Porch	
Windows	
Chimney	
Alterations	Active use cemetery

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C,D

Social Circle Historic Resource

Resource ID SC-48

Address Approximately 314 A P Henderson Dr

County Walton



NARGHIS ID 240287

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-49

Address Corner of Oak and Annie P Henderson

County Walton



NARGHIS ID 240288

Resource Type	Residential
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Continuous: concrete, veneer: brick
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-50

Address 213 Cannon St

County Walton



NARGHIS ID 240287

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Central Hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Unknown
Porch	Verandah
Windows	Double hung: 2/2
Chimney	Off-center ridgeline: brick
Alterations	Replacement materials, addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-51

Address 699 Beech Ave

County Walton



NARGHIS ID 240898

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Novelty siding, Brick
Foundation	Unknown
Porch	Verandah:
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-52 Gunter Hall

Address 425 W Hightower Tr

County Walton



NARGHIS ID 64935

Resource Type	Building
Resource Use	Social/Civic: Civic Club
Date of Construction	1875-1884
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Italianate
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Brick
Porch	Verandah
Windows	Double hung sash: 6/9, 6/6
Chimney	Both interior ends: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-53
Address 215 Clover Dr
County Walton



NARGHIS ID 240311

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Veneer: brick
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Enclosed verandah

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-54
Address 264 Cannon St
County Walton



NARGHIS ID 241005

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 Door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: Brick
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Chimney removed, replacement materials


Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-55
Address 325 Cedar St
County Walton

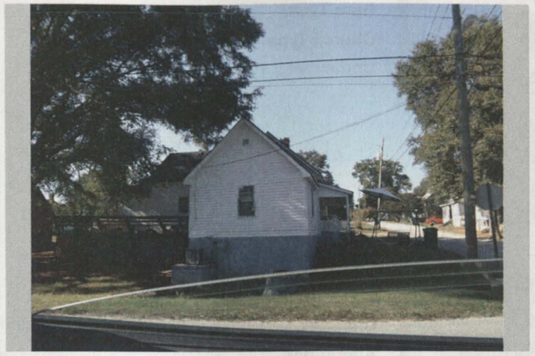

NARGHIS ID 241002

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: shiplap
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-56
Address 1242 West Hightower Tr
County Walton



NARGHIS ID 65119

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Wood: board-and-batten
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off-center ridgeline: brick
Alterations	Multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-57
Address 124 West Hightower Tr
County Walton



NARGHIS ID 240316

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1935-1944
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double hung: 6/6
Chimney	Off-center within roof surface: brick
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-58
Address 1188 West Hightower Tr
County Walton



NARGHIS ID 240318

Resource Type	Building
Resource Use	Vacant
Date of Construction	1930-1939
House Type	Pyramidal Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Brick
Porch	Verandah
Windows	Obscured
Chimney	Off-center ridgeline: brick
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-59
Address 905 West Hightower Rd
County Walton



NARGHIS ID 240358

Resource Type	Building
Resource Use	Vacant
Date of Construction	1950-1959
House Type	
Barn Type	
Church Type	
Commercial Type	Single retail
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick
Foundation	Continuous: brick
Porch	
Windows	Obscured
Chimney	No chimney observed
Alterations	Rear shed addition

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
A,C

Social Circle Historic Resource

Resource ID SC-60
Address 728 Beech Ave
County Walton



NARGHIS ID 240904

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Hip
Exterior Cladding	Veneer: brick
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-61
Address 913 West Hightower Tr
County Walton



NARGHIS ID 240359

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1970
House Type	Bungalow: cross
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 3/1, 1/1, 6/6
Chimney	Gable end interior: brick
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-62
Address 92 West Hightower Tr
County Walton



NARGHIS ID 240361

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam Wood
Style	No academic style
Roof	Gable: stepped
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-63
Address 92 West Hightower Tr
County Walton



NARGHIS ID 240362

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: shiplap; Synthetic siding: permastone
Foundation	Unknown
Porch	Verandah: front
Windows	Double hung sash: 6/6
Chimney	Off center within roof surface: brick
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-64
Address 92 West Hightower Rd
County Walton



NARGHIS ID 240363

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front
Exterior Cladding	Wood: plywood, Concrete block
Foundation	Brick
Porch	Portico
Windows	Double hung sash: 1/1, Fixed 6 pane
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-65
Address 1527 Cherokee Rd
County Walton



NARGHIS ID 240905

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Bungalow: side
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: stepped
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Portico; Carport
Windows	Double hung: 6/6; Fixed
Chimney	Off center with in roof surface: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-66
Address 1515 Cherokee Rd
County Walton



NARGHIS ID 240906

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: concrete
Porch	Portico: front
Windows	Double hung: 6/6
Chimney	Off-center within roof surf: brick
Alterations	Rear addition


Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-67
Address 1501 Cherokee Rd
County Walton

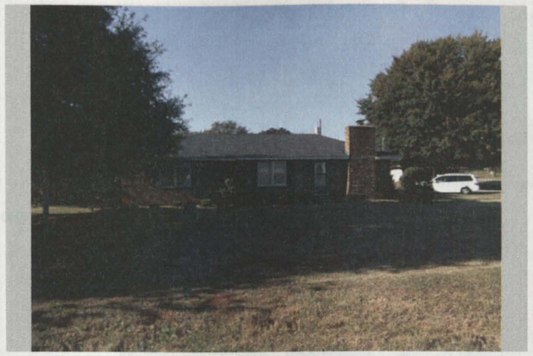

NARGHIS ID 240907

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop; Porte-cochere
Windows	Double hung sash: 2/2
Chimney	Lateral exterior: brick
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-68 Billy's Hair Salon
Address 1526 N Cherokee Rd
County Walton



NARGHIS ID 240448

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Recessed: front
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-69
Address 1520 Cherokee Rd
County Walton



NARGHIS ID 240449

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1975-1984
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and Beam
Style	No academic style
Roof	Gable: front; Hip
Exterior Cladding	Veneer: brick: running bond
Foundation	Continuous: brick
Porch	Verandah; Portico
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-70 Bar-B-Que Restaurant
Address 1501 N Cherokee Rd
County Walton



NARGHIS ID 240450

Resource Type	Building
Resource Use	Vacant
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	Restaurant
School Type	
Structural System	Concrete block
Style	No academic style
Roof	Gable: side
Exterior Cladding	
Foundation	Continuous: concrete
Porch	No porch
Windows	Double hung sash: 6/6; Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-71 Connor Family Cemetery
Address N. Cherokee Rd
County Walton



NARGHIS ID 240451

Resource Type	Site
Resource Use	Funerary: Cemetery
Date of Construction	1868
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	
Style	
Roof	
Exterior Cladding	
Foundation	
Porch	
Windows	
Chimney	
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
D

Social Circle Historic Resource

Resource ID SC-72
Address 1431 N. Cherokee Rd
County Walton



NARGHIS ID 240454

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Veneer: brick, running bond
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-73
Address 1523 Fairplay Rd
County Walton



NARGHIS ID 240455

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Veneer: brick
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-74
Address 230 South Cherokee Rd
County Walton



NARGHIS ID 65144

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1920-1929
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 4/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-75 Mars Hill Baptist Church
Address 425 W. Hightower Tr
County Walton



NARGHIS ID 240616

Resource Type	Building
Resource Use	Religious: Church
Date of Construction	1868
House Type	
Barn Type	
Church Type	Double Tower
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne: elements of style
Roof	Gable: front
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	Portico
Windows	Fixed
Chimney	No chimney observed
Alterations	Additions


Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-76
Address 431 N. Cherokee Rd
County Walton

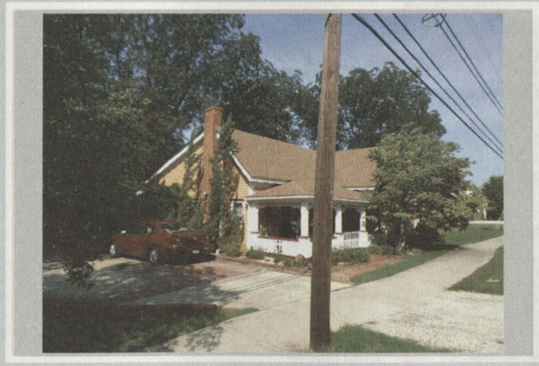

NARGHIS ID 240617

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian: elements
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Gable end exterior; Center: brick
Alterations	Additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-77
Address 341 W Hightower Trail
County Walton



NARGHIS ID 240656

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1840-1849
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah, Portico, Balcony
Windows	Double hung: 6/6
Chimney	Both gable ends: brick
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-78
Address 309 W Hightower Tr
County Walton



NARGHIS ID 240662

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical Revival
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah, Balcony
Windows	Double hung sash
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-79
Address 291 W Hightower Tr
County Walton



NARGHIS ID 240665

Resource Type	Building
Resource Use	Residential:Single Family Dwelling
Date of Construction	1880-1889
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Georgian, Greek Revival: elements
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	Off-ctr within roof surf, Lateral exterior
Alterations	Additions, Replacement materials

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-80
Address Approximately 225 W Hightower Tr
County Walton



NARGHIS ID 240668

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1890-1889
House Type	Queen Anne House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Wrap-around
Windows	Double hung sash: 2/2
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-81
Address 231 W Hightower Tr
County Walton



NARGHIS ID 240669

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Queen Anne Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Gable, Hip
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Off-ctr within roof surf, Lateral interior
Alterations	Side addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-82
Address 213 W Hightower Tr
County Walton



NARGHIS ID 240685

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1890-1889
House Type	Hall-parlor
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side, multi
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off center within roof surface: brick
Alterations	Additions, replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-83
Address 181 W Hightower Tr
County Walton



NARGHIS ID 240686

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	English cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Tudor, Colonial Revival: elements
Roof	Gable: cross
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Recessed: front; Verandah: side
Windows	Double hung sash: 6/6, 6/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-84
Address 195 W Hightower Tr
County Walton



NARGHIS ID 240687

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	English cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	English vernacular
Roof	Gable: multi, complex
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	No porch
Windows	Double hung sash: 6/6, 4/4; Fixed
Chimney	Gable end exterior: brick
Alterations	Additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-85
Address 150 South Forest Ave
County Walton



NARGHIS ID 240270

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1935-1944
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable:side
Exterior Cladding	Synthetic siding: asbestos
Foundation	Continuous: brick veneer
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Gable end exterior: brick
Alterations	Mid century alterations, rear addition

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-86
Address 147 South Forest Ave
County Walton



NARGHIS ID 240271

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1945-1954
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double hung sash: 3/1
Chimney	Off ctr within roof surface: brick
Alterations	Addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-87
Address 159 South Forest Ave
County Walton



NARGHIS ID 64924

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Wrap-around
Windows	Double hung sash:: 6/6, 2/2, 9/4
Chimney	Gable end exterior
Alterations	Replacement materials

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-88
Address 170 South Forest Ave
County Walton



NARGHIS ID 240272

Resource Type	Building
Resource Use	Residential: Multiple Family Dwelling:duplex
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Brick bearing
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	Off ctr within roof surface: brick
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-89

Address 195 South Forest Ave

County Walton



NARGHIS ID 240274

Resource Type	Building
Resource Use	Residential:Single Family Dwelling
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-90

Address 179 South Forest Ave

County Walton



NARGHIS ID 240275

Resource Type	Building
Resource Use	Residential: Multi Family Dwelling: duplex
Date of Construction	1910-1919
House Type	Central Hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Greek revival: elements
Roof	Gable: side
Exterior Cladding	Wood, Synthetic siding: masonite
Foundation	Unknown
Porch	Portico: front
Windows	Double hung sash: 6/6
Chimney	Gable end interior
Alterations	Additions

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-91

Address 167 West Hightower Tr

County Walton



NARGHIS ID 240908

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1945-1954
House Type	Side Gable Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: common bond
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 1/1; Fixed
Chimney	Off center, ridgeline: brick
Alterations	Enclosed side porch

Preliminary Assessment
Eligible

Status - Listed
Listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-92 Wiley General Store

Address 109 Cherokee Rd

County Walton

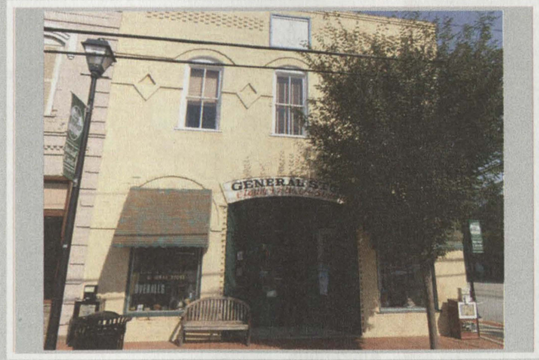

NARGHIS ID 64933

Resource Type	Building
Resource Use	Commercial: General Store
Date of Construction	1898
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: multiple retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 2/2; Fixed (2)
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-93 Post Office

Address 125 West Hightower Tr

County Walton



NARGHIS ID 240909

Resource Type	Building
Resource Use	Government: Post Office
Date of Construction	1970-1979
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick; Rusticated stone
Foundation	Continuous: concrete
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-94

Address 113 Cherokee Rd

County Walton



NARGHIS ID 64932

Resource Type	Building
Resource Use	Vacant
Date of Construction	1890-1899
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: multiple retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Continuous: brick
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-95

Address 125 West Hightower Tr

County Walton



NARGHIS ID 64931

Resource Type	Building
Resource Use	Commerical: Single Retail
Date of Construction	1890-1899
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block:multiple retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-96

Address 123 South Cherokee Rd

County Walton



NARGHIS ID 64930

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1890-1899
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-97

Address 129 S. Cherokee Rd

County Walton



NARGHIS ID 64929

Resource Type	Building
Resource Use	Vacant
Date of Construction	1880-1889
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: multiple retail
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Unknown
Exterior Cladding	Brick
Foundation	Unknown
Porch	No porch
Windows	Double hung sash: 6/1
Chimney	No chimney
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed


Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-98

Address 137 S. Cherokee Rd

County Walton

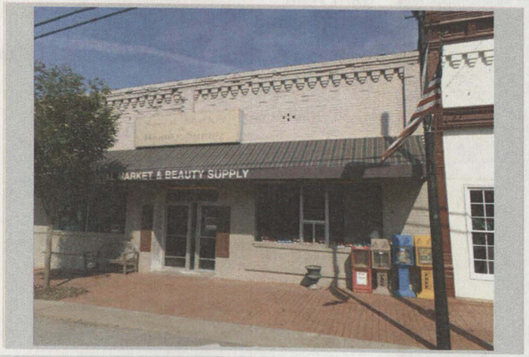

NARGHIS ID 64928

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1895-1904
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: Multiple retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Unknown
Exterior Cladding	Brick
Foundation	Unknown
Porch	No porch
Windows	Fixed
Chimney	No chimney
Alterations	Replacement materials

Preliminary Assessment Eligible

Status - Listed Listed


Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-99

Address 147 S. Cherokee Rd

County Walton

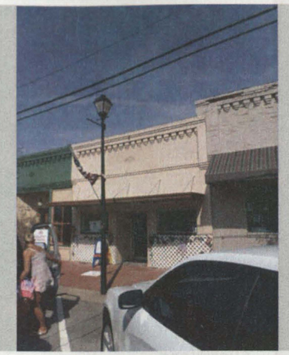

NARGHIS ID 64927

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1895-1904
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: Multiple Retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed: single
Chimney	No chimney
Alterations	Replacement materials

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-100

Address 145 S. Cherokee Rd

County Walton



NARGHIS ID 240371

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1895-1904
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: Multiple retail
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-101
Address 149, 153, 157 Cherokee Rd
County Walton



NARGHIS ID 64926

Resource Type	Building
Resource Use	Vacant
Date of Construction	1895-1904
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block:
School Type	
Structural System	Masonry
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed: 6/4, 1/2, 1/4
Chimney	No chimney
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-102 Circle View Cemetery
Address Corner of Lakewood Dr & Memorial St SW
County Walton



NARGHIS ID 240372

Resource Type	Site
Resource Use	Funerary: Cemetery
Date of Construction	1840
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	
Style	
Roof	
Exterior Cladding	
Foundation	
Porch	
Windows	
Chimney	
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not Listed

Applicable Criteria
D

Social Circle Historic Resource

Resource ID SC-103
Address 301 Hickory Dr
County Walton



NARGHIS ID 240910

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Hip
Exterior Cladding	Veneer: brick
Foundation	Continuous: concrete
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-104
Address 282 South Cherokee Rd.
County Walton



NARGHIS ID 241004

Resource Type	Building
Resource Use	Vacant
Date of Construction	1900-1909
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne
Roof	Gable on hip
Exterior Cladding	Synthetic siding: asbestos
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 15/1
Chimney	Off-center within roof: brick
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID Brown Towns House SC-105

Address 266 South Cherokee Rd

County Walton



NARGHIS ID 65143

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1850-1859
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Italianate
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah, Balcony
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-106

Address 347 Hickory St

County Walton



NARGHIS ID 240911

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Veneer: brick
Foundation	Continuous: concrete
Porch	Portico
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Large rear addition

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-107

Address 359 B Hickory Dr

County Walton



NARGHIS ID 240432

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: weatherboard; Veneer: brick
Foundation	Concrete: continuous
Porch	Portico
Windows	Double hung: 1/1, 6/6
Chimney	No chimney observed
Alterations	Addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-108

Address 441 Lakewood Dr

County Walton



NARGHIS ID 64939

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Center ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-109
Address 363 Wildwood Dr
County Walton



NARGHIS ID 240433

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Veneer: brick; Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-110
Address 302 Hickory St
County Walton



NARGHIS ID 240434

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Unknown
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Gable end: vinyl siding
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-111
Address 532 Hickory St
County Walton



NARGHIS ID 240435

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Veneer: brick; Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Gable end exterior: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-112
Address 500 Hickory St
County Walton



NARGHIS ID 240436

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1935-1944
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: asbestos
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung: 1/1, 9/9
Chimney	Both gable ends, exterior,brick
Alterations	Replacement materials, addition

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-113
Address 457 Hickory St
County Walton



NARGHIS ID 64962

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian: elements
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 4/4, 1/1
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-114
Address 350 Hickory Dr
County Walton



NARGHIS ID 240437

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Bungalow: hip
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-115
Address Adams St at E. Hightower
County Walton



NARGHIS ID 240457

Resource Type	Building
Resource Use	Vacant
Date of Construction	1930-1940
House Type	
Barn Type	
Church Type	
Commercial Type	Single Retail: Gas station
School Type	
Structural System	Brick bearing
Style	Craftsman: elements
Roof	Gable: side
Exterior Cladding	Brick
Foundation	Unknown
Porch	No porch
Windows	Double hung sash: 3/3, 2/2
Chimney	Center: brick
Alterations	Addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-116
Address 177 E Hightower Tr
County Walton



NARGHIS ID 240460

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1872, 1940, 1998
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian
Roof	Gable: front, side
Exterior Cladding	Wood: weatherboard
Foundation	Brick
Porch	Verandah
Windows	Double hung sash: 6/6; Fixed
Chimney	Gable end interior: brick
Alterations	Additions; Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-117
Address Dogwood Ave at E. Hightower Tr
County Walton



NARGHIS ID 240462

Resource Type	Building
Resource Use	Resdential: Single Family Dwelling
Date of Construction	1919-1924
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical, Prarie
Roof	Complex; Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Wrap-around
Windows	Double hung sash: 1/1
Chimney	Off ctr within roof surf
Alterations	Additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-118
Address 152 S. Dogwood Ave
County Walton



NARGHIS ID 240464

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1885-1894
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Second Empire
Roof	Mansard
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Off ctr within roof surf: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-119
Address 155 S. Dogwood Ave
County Walton



NARGHIS ID 240435

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1935-1945
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick; Wood: weatherboard
Foundation	Continuous: concrete
Porch	Portico
Windows	Double hung sash: 1/1, 6/6
Chimney	No chimney
Alterations	Addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-120
Address 207 E Hightower Tr
County Walton



NARGHIS ID 240466

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	Gabled ell house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian
Roof	Gable: multi
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Wrap-around
Windows	Double hung sash: 2/2
Chimney	Center, Off-ctr ridgeline: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-121 The Poets House

Address 255 E Hightower Tr

County Walton



NARGHIS ID 65154

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1870
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off-ctr within roof surf
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-122

Address 241 E Hightower Tr

County Walton



NARGHIS ID 240467

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	Queen Anne Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian, Queen Anne
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	continuous: brick
Porch	Wrap-around: F, S
Windows	Double hung sash: 1/1
Chimney	Off-ctr ridgeline: brick
Alterations	Additions, Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-123

Address 611 S Wildwood Dr

County Walton



NARGHIS ID 240378

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1940-1949
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-124

Address 623 Wildwood Dr

County Walton



NARGHIS ID 240380

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1934-1944
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off-ctr ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-125
Address 634 Wildwood Dr
County Walton



NARGHIS ID 240382

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Side Gable Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: asbestos
Foundation	Unknown
Porch	Portico
Windows	Double hung sash: 2/2, 6/6
Chimney	Off center, ridgeline: brick
Alterations	Replacement materials, shed addition

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-126
Address 641 Wildwood Dr
County Walton



NARGHIS ID 240944

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Hip
Exterior Cladding	Veneer: brick
Foundation	Continuous: concrete
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-127
Address 665 Wildwood Dr
County Walton



NARGHIS ID 240385

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-128
Address 806 Wildwood Dr
County Walton



NARGHIS ID 240393

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1940-1949
House Type	Bungalow: hip
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Concrete: block
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 4/4
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-129
Address 806 Wildwood Dr
County Walton



NARGHIS ID 240395

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic siding: vinyl
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center ridgeline, Gable-end exterior
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-130
Address 806 Wildwood Dr, located on same lot with SC-129
County Walton



NARGHIS ID 240397

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic siding: vinyl
Foundation	Unknown
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-131
Address 1280 Wildwood Dr
County Walton



NARGHIS ID 240398

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Veneer: brick
Foundation	Continuous: concrete
Porch	Portico
Windows	Double hung: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-132
Address 241 Marco Dr
County Walton



NARGHIS ID 240401

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side, front
Exterior Cladding	Veneer: brick, common
Foundation	Continuous: concrete
Porch	Portico
Windows	Double hung: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-133
Address 253 Marco Dr
County Walton



NARGHIS ID 240402

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: common Wood: vertical board
Foundation	Brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-134
Address 251 Marco Dr
County Walton



NARGHIS ID 240403

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side, stepped
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-135
Address Approximately 221 Marco Dr.
County Walton



NARGHIS ID 240404

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: common bond, Wood: Vertical board
Foundation	Brick: continuous
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-136
Address 221 Marco Dr
County Walton



NARGHIS ID 240405

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-137
Address 197 Marco Dr
County Walton



NARGHIS ID 240406

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-138
Address 208 Marco Dr
County Walton



NARGHIS ID 240407

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: common
Foundation	Brick: continuous
Porch	Stoop
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-139
Address 195 Collette Dr
County Walton



NARGHIS ID 240408

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick
Foundation	Brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-140
Address 453 Collette St
County Walton



NARGHIS ID 240409

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-141
Address 409 Marco Dr
County Walton



NARGHIS ID 240410

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Concrete: continuous
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	


Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-142
Address 417 Collette Ln
County Walton

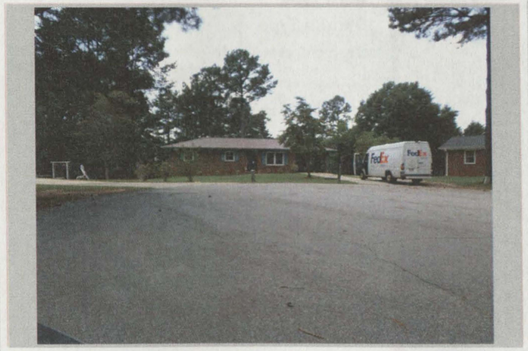

NARGHIS ID 240412

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running
Foundation	Brick
Porch	Stoop
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-143
Address 412 Collette Ln
County Walton



NARGHIS ID 240413

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-144
Address 235 S. Cherokee Rd
County Walton



NARGHIS ID 64952

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running
Foundation	Concrete: continuous
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-145
Address 219 South Cherokee Rd
County Walton



NARGHIS ID 240414

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1895-1905
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Hip on Gable
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: Queen Anne
Chimney	Lateral exterior: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-146
Address 184 South Cherokee Rd
County Walton



NARGHIS ID 240415

Resource Type	Building
Resource Use	Commercial: Hotel
Date of Construction	1965-1974
House Type	
Barn Type	
Church Type	
Commercial Type	Single retail
School Type	
Structural System	Post-and-beam
Style	No academic style
Roof	Mansard
Exterior Cladding	Brick
Foundation	Continuous: brick
Porch	Verandah
Windows	Fixed
Chimney	No chimney observed
Alterations	


Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
A, C

Social Circle Historic Resource

Resource ID SC-147 Social Circle United Methodist
Address 261 St Rte 11
County Walton

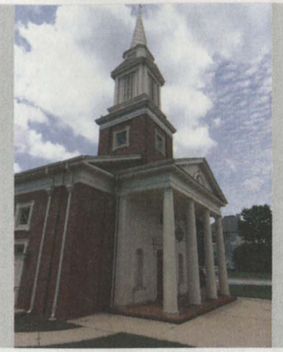

NARGHIS ID 240416

Resource Type	Building
Resource Use	Religious: Church
Date of Construction	1970
House Type	
Barn Type	
Church Type	Front gable
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial Revival
Roof	Gable: front; Hip
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Portico; Porte-Cochere
Windows	Triple-hung: 9/9/9
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-148 Pure Gas Station
Address 165 S Cherokee Rd
County Walton



NARGHIS ID 240424

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1955-1964
House Type	
Barn Type	
Church Type	
Commercial Type	Single retail
School Type	
Structural System	Unknown
Style	N/A
Roof	Flat
Exterior Cladding	Brick: running
Foundation	Brick; Concrete
Porch	No porch
Windows	Fixed: single
Chimney	Off-center within roof surface
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-149
Address 259 SW Memorial St
County Walton



NARGHIS ID 240245

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic: vinyl siding
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-150
Address 261 SW Memorial St
County Walton



NARGHIS ID 240426

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick, Synthetic: vinyl siding
Foundation	Continuous: brick
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-151
Address 262 S Forest Ave
County Walton



NARGHIS ID 240427

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	Balcony
Windows	Double hung sash: 6/6; Fixed: 3/5
Chimney	Off-ctr within roof surface
Alterations	Rear Addition

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-152
Address 191 SW Memorial St
County Walton



NARGHIS ID 240428

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic Siding: Vinyl
Foundation	Brick: continuous
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Addition

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-153
Address 103 Gabriel Way
County Walton



NARGHIS ID 240429

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1975-1984
House Type	Georgian house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Gable: side
Exterior Cladding	Brick: common bond; Wood: Weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 6/6; Fixed: 2/5
Chimney	Gable-end exterior: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-154
Address 428 Branham Cir
County Walton



NARGHIS ID 240430

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1975-1984
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-155
Address 398 Branham Cir
County Walton



NARGHIS ID 240438

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1975-1984
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Brick; Fieldstone
Foundation	Concrete: continuous
Porch	No porch observed
Windows	Fixed
Chimney	Off-ctr within roof surface:brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-156
Address 351 Branham Cir
County Walton



NARGHIS ID 240439

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1975-1984
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running
Foundation	Brick; Concrete
Porch	Arcade
Windows	Double hung sash: 6/6; Fixed (1)
Chimney	Off-ctr within roof surface: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-157
Address 371 Branham Cir
County Walton



NARGHIS ID 240440

Resource Type	Single Family Dwelling
Resource Use	Residential
Date of Construction	1975-1984
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	No chimney observed
Windows	Double hung sash: 1/1, 6/6
Chimney	Off-center within roof surface: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-158
Address 265 E Hightower Tr
County Walton



NARGHIS ID 240441

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1975-1984
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: common
Foundation	Concrete: continuous
Porch	Recessed
Windows	Jalousie, Double hung sash: 2/2
Chimney	Center ridgeline: brick
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-159
Address 257 E Hightower Tr
County Walton



NARGHIS ID 240442

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	English cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running; Stucco
Foundation	Brick
Porch	Stoop
Windows	Double hung; Casement; Fixed
Chimney	Gable-end exterior
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-160
Address 246 E Hightower Tr
County Walton



NARGHIS ID 65153

Resource Type	Building
Resource Use	Vacant
Date of Construction	1905-1914
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical revival
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Brick: continuous
Porch	Verandah; Balcony
Windows	Double hung sash: 2/2; Fixed
Chimney	Gable-end exterior; Off-ctr within roof: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-161
Address 162 Dogwood Ave
County Walton



NARGHIS ID 65155

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Neoclassical elements
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: Brick
Porch	Verandah
Windows	Double hung sash: complex
Chimney	Off-center within roof surface: brick
Alterations	Rear shed addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-162
Address Birch Circle at Hill Ave
County Walton



NARGHIS ID 240982

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Complex hip
Exterior Cladding	Brick: common bond
Foundation	Brick; Concrete: continuous
Porch	Verandah: 2nd floor; Wrap-around
Windows	Double hung sash: 1/1
Chimney	Off-center ridgeline; Center: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-163
Address 172 E Hightower Tr
County Walton



NARGHIS ID 65161

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian; Queen Anne
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Wrap-around
Windows	Double hung sash: 2/2
Chimney	Off-center within roof surf: brick
Alterations	Addition, replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-164
Address N Cherokee Rd at E Hightower Trl
County Walton



NARGHIS ID 240245

Resource Type	Building
Resource Use	Vacant
Date of Construction	1955-1964
House Type	
Barn Type	
Church Type	
Commercial Type	Single retail:gas station
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip; Complex
Exterior Cladding	Concrete block
Foundation	Concrete: slab
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-165
Address 147 N Cherokee Rd
County Walton



NARGHIS ID 240246

Resource Type	Building
Resource Use	Vacant
Date of Construction	1910-1919
House Type	Georgian house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical revival
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Porte cochere; Arcade; Stoop; Balcony
Windows	Double hung sash: 1/1
Chimney	Off-center within roof surf: brick
Alterations	

Preliminary Assessment Eligible
Status - Listed Listed
Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-166
Address 163 N Cherokee Rd
County Walton



NARGHIS ID 240248

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1905-1914
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double hung: 1/1, 2/2
Chimney	Off-centerr within roof surf: brick
Alterations	

Preliminary Assessment Eligible
Status - Listed Listed
Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-167
Address 195 N Cherokee Rd
County Walton



NARGHIS ID 240252

Resource Type	Building
Resource Use	Religious: Church/School
Date of Construction	1910
House Type	
Barn Type	
Church Type	Double tower
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Gothic revival
Roof	Complex
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment Eligible
Status - Listed Listed
Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-168
Address 221 N Cherokee Rd
County Walton



NARGHIS ID 65131

Resource Type	Building
Resource Use	Vacant
Date of Construction	1905-1914
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Gable: side; Hip
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surf: stucco
Alterations	

Preliminary Assessment Eligible
Status - Listed Listed
Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-169
Address 255 N Cherokee Rd
County Walton



NARGHIS ID 65132

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1920-1929
House Type	English cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Tudor; English vernacular
Roof	Gable: side
Exterior Cladding	Brick: common
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 3/1
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-170
Address 271 N Cherokee Rd
County Walton



NARGHIS ID 65133

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1905-1914
House Type	New South cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Gable: multi
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung: 6/6
Chimney	Off-center ridgeline: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-171
Address 291 N Cherokee Rd
County Walton



NARGHIS ID 65134

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900
House Type	Georgian house
Barn Type	
Church Type	
Commercial Type	Retail: funeral home
School Type	
Structural System	Balloon frame
Style	Neoclassical revival
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Stoop
Windows	Double hung sash: 3/3
Chimney	Off-center within roof surf: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-172
Address 317 N Cherokee Rd
County Walton



NARGHIS ID 240262

Resource Type	Building
Resource Use	Residential: Single family residential
Date of Construction	1915-1924
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Brick: continuous
Porch	Verandah
Windows	Double hung sash: 6/6; 4/4
Chimney	Center; Off-center ridgeline: brick
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-173
Address 353 N Cherokee Rd
County Walton



NARGHIS ID 65139

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1925-1934
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Tudor
Roof	Gable: side, front
Exterior Cladding	Brick: common
Foundation	Continuous: brick
Porch	Portico; Porte-cochere
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surf: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-174
Address 375 N Cherokee Road
County Walton



NARGHIS ID 65135

Resource Type	Building
Resource Use	Vacant
Date of Construction	1910-1919
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical revival
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Brick: continuous
Porch	Wrap-around; Portico
Windows	Double hung: 1/1
Chimney	Center; Off-ctr ridgeline; Gable end: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-175
Address 421 N Cherokee Rd
County Walton



NARGHIS ID 240265

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1924
House Type	Georgian house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continous: concrete
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surf: brick
Alterations	Addition

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-176
Address 435 N Cherokee Rd
County Walton



NARGHIS ID 65136

Resource Type	Building
Resource Use	Residential: Single family residential
Date of Construction	1910-1919
House Type	New South cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: multi
Exterior Cladding	Wood: weatherboard
Foundation	Brick: continuous
Porch	Verandah
Windows	Double hung: 1/1, 2/2; Fixed
Chimney	Center; Off-center ridgeline; Gable end: brick
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-177
Address 453 N Cherokee Rd
County Walton



NARGHIS ID 65135

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1904-1914
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman; Queen Anne
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	Off-center within roof surf: brick
Alterations	Additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-178
Address 511 N Cherokee Rd
County Walton



NARGHIS ID 240268

Resource Type	Building
Resource Use	Residential: Single family residential
Date of Construction	1887
House Type	Unknown
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: style
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Stoop; Porte-cochere
Windows	Double hung sash: 6/1
Chimney	Gable end exterior: brick
Alterations	Multiple additions; Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-179
Address 549 N Cherokee Rd
County Walton



NARGHIS ID 65117

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1915-1924
House Type	English cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	English vernacular
Roof	Gable: side
Exterior Cladding	Brick: running
Foundation	Continuous: brick
Porch	Verandah; Portico
Windows	Double hung sash: 4/4
Chimney	Gable end interior; Off-center ridgeline: brick
Alterations	Rear Addition

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-180
Address 149 Sycamore St
County Walton



NARGHIS ID 240379

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1910-1919
House Type	Shotgun
Barn Type	
Church Type	
Commercial Type	Business
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 2/2; Fixed
Chimney	Center: brick
Alterations	Multiple additions; Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-181
Address 146 Sycamore St
County Walton



NARGHIS ID 240381

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1955-1964
House Type	
Barn Type	
Church Type	
Commercial Type	Single retail
School Type	
Structural System	Brick bearing
Style	No academic style
Roof	Flat
Exterior Cladding	Brick
Foundation	Brick
Porch	Stoop
Windows	N/A
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-182
Address 166 Sycamore St
County Walton



NARGHIS ID

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Gable: front; hip
Exterior Cladding	Wood: drop siding; weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Off-center within roof surface: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-183 Great Walton Railroad Office
Address 200 S. Dogwood Ave
County Walton



NARGHIS ID 240381

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1913
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial: train depot
School Type	
Structural System	Brick bearing
Style	No academic style
Roof	Flat
Exterior Cladding	Brick
Foundation	Concrete
Porch	Stoop
Windows	N/A
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-184
Address Mid Block Adams St.
County Walton



NARGHIS ID 240387

Resource Type	Building
Resource Use	Vacant
Date of Construction	1935-1944
House Type	
Barn Type	
Church Type	
Commercial Type	Single retail
School Type	
Structural System	Concrete frame
Style	No academic style
Roof	Flat
Exterior Cladding	Concrete block
Foundation	Concrete
Porch	None
Windows	Unknown
Chimney	None
Alterations	

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-185
Address 135 S Dogwood Ave
County Walton



NARGHIS ID 240390

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Queen Anne Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: fixed
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-186
Address 151 S. Dogwood Ave
County Walton



NARGHIS ID 240391

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Georgian Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial Revival
Roof	Hip
Exterior Cladding	Wood, weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 1/1 and 2/2
Chimney	Off center within roof surface: brick
Alterations	Enclosed verandah

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-187
Address 174 S Dogwood Ave
County Walton



NARGHIS ID 240392

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1905-1914
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash, 2/2
Chimney	Off center within roof surface: brick
Alterations	Addition to porch, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-188
Address 193 S. Dogwood Ave
County Walton



NARGHIS ID 240394

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Cross gable
Exterior Cladding	Wood: weatherboard
Foundation	Brick
Porch	Verandah
Windows	Double hung sash: 1/1, 2/2
Chimney	
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-189
Address 165 Holly Ave
County Walton



NARGHIS ID 240396

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon framing
Style	Craftsman
Roof	Gable: cross
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off center within roof surface: brick
Alterations	Material replacement

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-190
Address 155 Holly Ave
County Walton



NARGHIS ID 240399

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne
Roof	Hip, front gable
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Off center within roof surface: brick
Alterations	Rear addition

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-191
Address 224 Spring St
County Walton



NARGHIS ID 240912

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Unknown
Porch	Verandah; Stoop
Windows	Double-hung sash: 2/2
Chimney	Center ridgeline: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-192
Address 128 Hollis Ave
County Walton



NARGHIS ID 240400

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1945-1954
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Gable: side
Exterior Cladding	Synthetic siding: Asbestos
Foundation	Brick: continuous
Porch	Verandah; Stoop
Windows	Double hung sash: 8/8
Chimney	Off-center ridgeline: brick
Alterations	Screened in porch

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-193
Address 144 S Holly Stt
County Walton



NARGHIS ID 240417

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double-hung sash: 2/2, 1/1; Fixed
Chimney	Off-center, ridgeline: brick
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-194
Address 156 S. Holly St
County Walton



NARGHIS ID 240418

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsmen; English Vernacular
Roof	Gable: side
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Continuous: concrete
Porch	Verandah; Stoop
Windows	Double hung sash: 3/1
Chimney	Lateral exterior: brick
Alterations	Replacement materials, enclosed porch

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-195
Address 166 Holly Ave
County Walton



NARGHIS ID 240419

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1945-1954
House Type	Side Gable Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Folk victorian; Colonial revival
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Portico
Windows	Double-hung sash: 6/6; Casement
Chimney	Off-center within roof: brick
Alterations	Addition, replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-196
Address 182 Holly Ave
County Walton



NARGHIS ID 240420

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival elements
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Portico
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Enclosed porch

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-197
Address 198 Dogwood Ave
County Walton



NARGHIS ID 240421

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1914
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Colonial revival elements
Roof	Complex hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double-hung sash: 1/1
Chimney	Off-center within roof: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-198
Address 174 Dogwood Ave
County Walton



NARGHIS ID 240422

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	Off-center ridgeline: brick with stucco
Alterations	Screened porch

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-199
Address 162 Dogwood Ave
County Walton



NARGHIS ID 240423

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	Central hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double-hung sash: 2/2
Chimney	Gable end exterior: brick
Alterations	Multiple additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-200 Gibbs Barton Woodstock
Address 478 N Hightower Rd
County Walton



NARGHIS ID 240502

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Queen Anne House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Complex hip
Exterior Cladding	Wood: weatherboard; Concrete
Foundation	Brick; Concrete: continuous
Porch	Verandah; Wrap-around
Windows	Double hung sash: 1/1
Chimney	Off-center ridgeline; Center: brick
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-201

Address 508 Hightower Tr

County Walton



NARGHIS ID 240503

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	Center ridgeline; brick
Alterations	Large side addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-202

Address 511 W. Hightower Tr

County Walton



NARGHIS ID 64934

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1900-1909
House Type	New South cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic type
Roof	Gable, multi
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: Brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Off center ridgeline: brick
Alterations	Rear addition; large side addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-203

Address 586 Hightower Tr

County Walton



NARGHIS ID 240504

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Brick: running bond
Foundation	Continuous: Brick
Porch	Portico
Windows	Double hung sash: 4/4
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-204

Address 680 W. Hightower Tr

County Walton



NARGHIS ID 240505

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic type
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: Brick
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-205
Address 790 W. Hightower Tr
County Walton



NARGHIS ID 240518

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1940-1949
House Type	Bunglow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon framing
Style	No academic style
Roof	Gable: side
Exterior Cladding	Concrete block
Foundation	Continuous: concrete block
Porch	Portico
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-206
Address 792 W. Hightower Tr
County Walton



NARGHIS ID 240519

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial Revival
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Concrete slab
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-207
Address 717 W. Hightower Tr
County Walton



NARGHIS ID 240518

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Stone veneer, Wood: vertical board
Foundation	Concrete slab
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-208
Address 701 W. Hightower Tr
County Walton



NARGHIS ID 240519

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Concrete slab
Porch	Portico
Windows	Double hung sash, 6/6
Chimney	No chimney observed
Alterations	Enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-209
Address 685 W. Hightower Tr
County Walton



NARGHIS ID 240518

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: front
Exterior Cladding	Stone: veneer, Wood: vertical board
Foundation	Concrete slab
Porch	Recessed and carport
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-210
Address 661 W. Hightower Tr
County Walton



NARGHIS ID 240524

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Concrete slab
Porch	Front Portico
Windows	Double hung sash: 6/6, 8/1
Chimney	Center ridgeline: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-211
Address 631 W. Hightower Tr
County Walton



NARGHIS ID 240525

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1970
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double-hung sash: 6/6
Chimney	No chimney observed
Alterations	Enclosed carport, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-212
Address 478 Hightower Tr
County Walton



NARGHIS ID 240527

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Brick: running
Foundation	Brick; Concrete
Porch	Verandah; Recessed; Portico; Carport
Windows	Jalousie; Chicago
Chimney	Off-center within roof surf: brick
Alterations	Enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-213
Address 168 Carver Dr
County Walton



NARGHIS ID 240536

Resource Type	Site
Resource Use	Funerary: Cemetery
Date of Construction	1881
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	
Style	
Roof	
Exterior Cladding	
Foundation	
Porch	
Windows	
Chimney	
Alterations	Actively Used

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
D

Social Circle Historic Resource

Resource ID SC-214
Address 308 Hickory Dr
County Walton



NARGHIS ID 240538

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Wood: board and batten; novelty
Foundation	Continuous: brick
Porch	Recessed: front
Windows	Double hung sash: 4/4; Jalousie
Chimney	Center ridgeline: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
A, C

Social Circle Historic Resource

Resource ID SC-215
Address 314 Hickory Dr
County Walton



NARGHIS ID 240540

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 4/4; Jalousie
Chimney	Center ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-216
Address 322 Hickory Dr
County Walton



NARGHIS ID 240542

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Wood: board and batten; novelty
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 4/4
Chimney	Center ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-217
Address 326 Hickory Dr
County Walton



NARGHIS ID 240545

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 4/4; Jalousie
Chimney	Center ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-218
Address 334 Hickory Dr
County Walton



NARGHIS ID 240549

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Wood: board and batten; novelty
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 4/4; Jalousie
Chimney	Center ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-219
Address 342 Hickory Dr
County Walton



NARGHIS ID 240564

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic Siding: asbestos
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 2/2; Jalousie
Chimney	Center ridgeline: brick
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-220
Address 333 Hickory Dr
County Walton



NARGHIS ID 240549

Resource Type	Building
Resource Use	Residential:Single Family Dwelling
Date of Construction	1930-1939
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic siding: asbestos
Foundation	Vontinuous: concrete block
Porch	Recessed
Windows	Double hung sash: 1/1
Chimney	Off center within roof surface: brick
Alterations	Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-221

Address 359 Hickory Dr

County Walton



NARGHIS ID 240562

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: weatherboard; Brick: runr
Foundation	Continuous: Brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Rear Addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-222

Address 333 Hickory Dr

County Walton

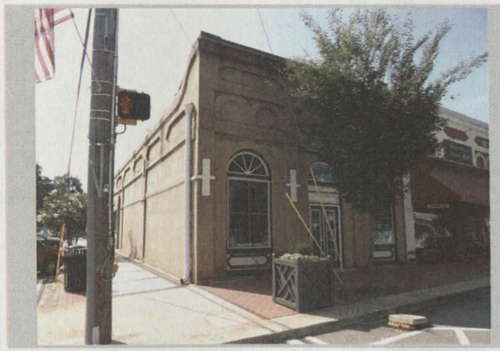

NARGHIS ID 240567

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Unknown
Style	Folk Victorian
Roof	Partial parapet
Exterior Cladding	Stucco
Foundation	Concrete
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-223 Social Circle Antique Mall

Address 116 Cherokee Rd

County Walton

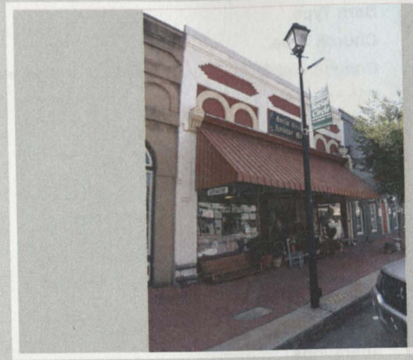

NARGHIS ID 65145

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Brick bearing
Style	Folk Victorian
Roof	Parapet
Exterior Cladding	Brick: common bond
Foundation	Stone; Concrete: continuous
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-224

Address 120 Cherokee Rd

County Walton



NARGHIS ID 240584

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Brick bearing
Style	No academic style
Roof	Parapet
Exterior Cladding	Stucco
Foundation	Brick; Concrete: continuous
Porch	No porch observed
Windows	Double hung sash: 6/6; Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-225

Address 124 Cherokee Rd

County Walton



NARGHIS ID 240585

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Brick bearing
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	No porch observed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-226

Address 130 Cherokee Rd

County Walton

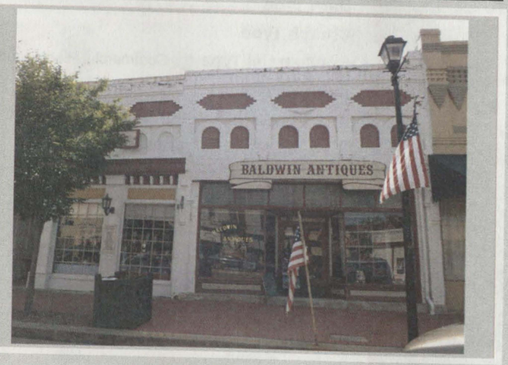

NARGHIS ID 240586

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Brick bearing
Style	Folk Victorian
Roof	Parapet
Exterior Cladding	Brick: common bond
Foundation	Brick; Stone: continuous
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-227

Address 132 S Cherokee Rd

County Walton



NARGHIS ID 240587

Resource Type	Building
Resource Use	Religious: Church
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Brick bearing
Style	Folk Victorian
Roof	Parapet
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-228

Address 136 Cherokee St

County Walton



NARGHIS ID 65148

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1885-1894
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: Multiple retail
School Type	
Structural System	Brick bearing
Style	Folk Victorian
Roof	Parapet
Exterior Cladding	Brick: common bond
Foundation	Brick; Stone: continuous
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-229
Address 575 N Cherokee Rd
County Walton



NARGHIS ID 240588

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1940-1949
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah; Portico
Windows	Double hung sash: 2/2
Chimney	Off-center within roof surf: brick
Alterations	Enclosed verandah, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-230
Address 292 S. Cherokee Rd
County Walton



NARGHIS ID 240377

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Complex
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-231
Address 605 N Cherokee Rd
County Walton



NARGHIS ID 240590

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1950-1959
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surf: brick
Alterations	Enclosed verandah, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-232
Address 637 N Cherokee Rd
County Walton



NARGHIS ID 240591

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Double pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials, addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-233
Address 654 N Cherokee Rd
County Walton



NARGHIS ID 240607

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1930-1939
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Continuous: brick
Porch	Portico: front
Windows	Double hung sash: 4/4; Jalousie
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-234
Address 681 N Cherokee Rd
County Walton



NARGHIS ID 240609

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Carport enclosed, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-235
Address 701 N Cherokee Rd
County Walton



NARGHIS ID 240610

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6; Jalousie
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-236
Address 803 N Cherokee Rd
County Walton



NARGHIS ID 240611

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1940-49
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Brick: continuous
Porch	Verandah; Portico
Windows	Double hung sash: 3/1
Chimney	Off-center ridgeline: brick
Alterations	Addition, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-237
Address 887 N Cherokee Rd
County Walton



NARGHIS ID 240612

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: stepped
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials, enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-238
Address 903 N Cherokee Rd
County Walton



NARGHIS ID 240618

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1940-1949
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic Siding: asbestos
Foundation	Continuous: concrete block
Porch	Portico
Windows	Double hung sash: 1/1, 2/2
Chimney	Off-center ridgeline: brick
Alterations	Rear addition, replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-239
Address 1011 N Cherokee Rd
County Walton



NARGHIS ID 240619

Resource Type	Bulding
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Gable end exterior: brick
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-240
Address 1051 N Cherokee Rd
County Walton



NARGHIS ID 240620

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1920
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic Siding: asbestos
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-241
Address 1059 N Cherokee Rd
County Walton



NARGHIS ID 240621

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-242
Address 1081 N Cherokee Rd
County Walton



NARGHIS ID 240623

Resource Type	Buuilding
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah: front
Windows	Double hung sash: 1/1, 2/2
Chimney	Gable end interior: stuccoed masonry
Alterations	Multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-243
Address 1127 N Cherokee Rd
County Walton



NARGHIS ID 240622

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1940-1949
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Pier with infill: brick
Porch	Stoop
Windows	Double hung sash: 2/2, 6/6; Fixed
Chimney	Off-center ridgeline: brick
Alterations	Enclosed front verandah, Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-244
Address 1155 N Cherokee Rd
County Walton



NARGHIS ID 240624

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1945-1954
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic Siding: asbestos
Foundation	continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surf: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-245
Address 1175 N Cherokee Rd
County Walton



NARGHIS ID 240625

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1945-1954
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic Siding: asbestos
Foundation	Pier with infill: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Off-center within ridgeline: brick
Alterations	Rear Additions, replacement materials

Preliminary Assessment	Status - Listed	Applicable Criteria
Not Wligible	Not listed	C

Social Circle Historic Resource

Resource ID SC-246
Address 192 E Hightower Trl
County Walton



NARGHIS ID 65159

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Unknown
Porch	Portico
Windows	Double hung sash : 24/1
Chimney	Off-center within roof surf; Gable end exterior:brick
Alterations	

Preliminary Assessment	Status - Listed	Applicable Criteria
Eligible	Listed	C

Social Circle Historic Resource

Resource ID SC-247
Address 1276 N Cherokee Rd
County Walton



NARGHIS ID 240627

Resource Type	
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Enclosed carport

Preliminary Assessment	Status - Listed	Applicable Criteria
Not Eligible	Not listed	C

Social Circle Historic Resource

Resource ID SC-248
Address 1210 N Cherokee Rd
County Walton



NARGHIS ID 240628

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop
Windows	Double hung sash: 2/2; Fixed
Chimney	No chimney observed
Alterations	Enclosed garage

Preliminary Assessment	Status - Listed	Applicable Criteria
Not Eligible	Not listed	C

Social Circle Historic Resource

Resource ID SC-249
Address 142 S Dogwood Ave
County Walton



NARGHIS ID 65168

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front; Hip
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Obscured
Porch	Verandah
Windows	Double hung sash: 6/6, 1/1
Chimney	Off-center within roof surf: brick
Alterations	Addition, replacement materials

Preliminary Assessment: Eligible
Status - Listed: Listed
Applicable Criteria: C

Social Circle Historic Resource

Resource ID SC-250
Address 210 Holly Ave
County Walton



NARGHIS ID 240608

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1940-1949
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: stepped
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double hung sash: 2/2; Fixed
Chimney	Off-center within roof surf: brick
Alterations	Replacement materials, additions

Preliminary Assessment: Not Eligible
Status - Listed: Listed
Applicable Criteria: C

Social Circle Historic Resource

Resource ID SC-251
Address 224 Holly St
County Walton



NARGHIS ID 240613

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: obscured
Chimney	Off-center within roof surf: brick
Alterations	Replacement materials

Preliminary Assessment: Eligible
Status - Listed: Listed
Applicable Criteria: C

Social Circle Historic Resource

Resource ID SC-252
Address 238 Holly St
County Walton



NARGHIS ID 240614

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1900-1909
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic Siding: vinyl
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 2/2, 1/1
Chimney	Center ridgeline: brick
Alterations	Additions

Preliminary Assessment: Not eligible
Status - Listed: Listed
Applicable Criteria: C

Social Circle Historic Resource

Resource ID SC-253
Address 464 Sweetgum St
County Walton



NARGHIS ID 240615

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic Siding: aluminium
Foundation	Continuous: concrete block
Porch	Stoop: front
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-254
Address 422 Sweetgum St
County Walton



NARGHIS ID 240629

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-255
Address 416 Sweetgum St
County Walton



NARGHIS ID 240630

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick, concrete
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-256
Address 396 Sweetgum St
County Walton



NARGHIS ID 240631

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-257
Address 386 Sweetgum St
County Walton



NARGHIS ID 240635

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double-hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-258
Address 369 Sweetgum St
County Walton



NARGHIS ID 240637

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double-hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-259
Address Sweetgum St at Oak Dr
County Walton



NARGHIS ID 240639

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-260
Address 402 East Willow Dr
County Walton



NARGHIS ID 240641

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: hip
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill; brick
Porch	Verandah
Windows	Double hung sash: 2/2, 6/6
Chimney	No chimney observed
Alterations	Rear addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-261
Address 422 E Willow Dr
County Walton



NARGHIS ID 240642

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: multi
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 2/2, 6/6
Chimney	Gable-end, exterior; center ridgeline: brick
Alterations	Replacement materials, enclosed porch

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-262
Address 460 Oak St
County Walton



NARGHIS ID 240644

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and Beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond; Synthetic Siding: vinyl
Foundation	Continuous: brick, concrete
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials, addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-263
Address 401 Oak St
County Walton



NARGHIS ID 240645

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick, concrete
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-264
Address 387 Oak St
County Walton



NARGHIS ID 240646

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: stepped
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick, concrete
Porch	Verandah
Windows	Double hung sash: 2/2, Chicago
Chimney	No chimney observed
Alterations	Replacement materials, enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-265

Address 385 Oak St

County Walton



NARGHIS ID 240647

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: Running Bond
Foundation	Continous: brick, concrete block
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Enclosed carport, enclosed porch, addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-266

Address 363 Oak St

County Walton



NARGHIS ID 240649

Resource Type	Building
Resource Use	Residential:Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: Running bond
Foundation	Continuous: brick, concrete
Porch	Stoop
Windows	Double hung sash: 2/2, Chicago
Chimney	No chimney observed
Alterations	Rear addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-267

Address 351 Oak St

County Walton



NARGHIS ID 240649

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick, concrete block
Porch	Stoop
Windows	Double hung sash: 2/2; Jalousie
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-268

Address 1 mile east of junction St Rte 11 and Cannon Rd

County Walton



NARGHIS ID 240663

Resource Type	Site
Resource Use	Religious: funerary
Date of Construction	1900
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	
Style	
Roof	
Exterior Cladding	
Foundation	
Porch	
Windows	
Chimney	
Alterations	Active use cemetery

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C, D

Social Circle Historic Resource

Resource ID SC-269

Address 1200 N. Cherokee Rd

County Walton



NARGHIS ID 240648

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: cross and hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick and concrete block
Porch	Stoop
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Rear shed addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-270

Address 1180 N. Cherokee Rd.

County Walton



NARGHIS ID 240469

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Side Gable Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Portico; verandah
Windows	Double hung sash: 2/2
Chimney	Center: brick
Alterations	Rear hip addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-271

Address 708 Beech Ave

County Walton



NARGHIS ID 240915

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continous: Brick
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-272

Address 1328 Boxwood St

County Walton



NARGHIS ID 240470

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Continuous: Brick
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Altered porch and front entry

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-273

Address 327 Boxwood St

County Walton



NARGHIS ID 240471

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	Colonial Revival: elements
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: Brick
Porch	Front stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-274

Address 341 Boxwood St

County Walton



NARGHIS ID 240472

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Continuous: Brick
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-275

Address 332 Boxwood St

County Walton



NARGHIS ID 240473

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: Brick
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Enclosed carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-276

Address 330 Boxwood St

County Walton

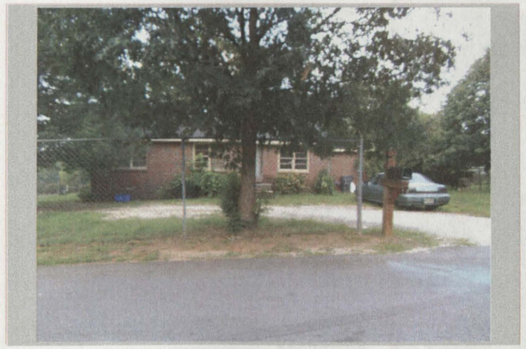

NARGHIS ID 240474

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: stepped
Exterior Cladding	Brick: common bond
Foundation	Continuous: Brick
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Enclosed garage

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-277

Address 304 Boxwood St

County Walton



NARGHIS ID 240475

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: Brick
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-278

Address 298 S. Cherokee Rd

County Walton



NARGHIS ID 240376

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1920-1929
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: Brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Off center ridgeline: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-279

Address 275 Poplar Ave

County Walton



NARGHIS ID 240477

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1970-1979
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: Brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-280

Address 295 Poplar Ave

County Walton



NARGHIS ID 240479

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic siding: Vinyl siding
Foundation	Brick
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-281

Address 355 Poplar Ave

County Walton



NARGHIS ID 65098

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1930
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-282

Address 342 Poplar Ave

County Walton



NARGHIS ID 240481

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Gabled-ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Addition; replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-283

Address 639 Beech Ave

County Walton



NARGHIS ID 240916

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1950-1959
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Masonite
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-284

Address 608 Beech Ave

County Walton



NARGHIS ID 240917

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1955-1964
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double hung sash: 1/1
Chimney	Off-center ridgeline: brick
Alterations	Addition; enclosed verandah

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-285

Address 280 Carver Dr

County Walton



NARGHIS ID 240919

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Side addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-286

Address 385 Carver Dr

County Walton



NARGHIS ID 240920

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1945-1954
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front
Exterior Cladding	Synthetic siding: Masonite
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 4/4
Chimney	No chimney observed
Alterations	Replacement materials, addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-287

Address 228 Oak Dr

County Walton



NARGHIS ID 240921

Resource Type	Building
Resource Use	Residential; Single family dwelling
Date of Construction	1910-1919
House Type	Central hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Masonite
Foundation	Continuous: birck
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Gable end exterior: stuccoed masonry
Alterations	Replacement materials; multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-288 Corinth Baptist Church

Address 373 Dogwood Ave

County Walton



NARGHIS ID 240913

Resource Type	Building
Resource Use	Religious: Church
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Stucco
Foundation	Continuous: concrete block
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Integrated carport

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-289

Address 308 Dogwood Dr

County Walton



NARGHIS ID 240914

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1925-1934
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Gable end exterior: brick
Alterations	Addition; replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-290

Address 285 Jones Dr

County Walton



NARGHIS ID 240918

Resource Type	Building
Resource Use	Residential; Single family dwelling
Date of Construction	1910-1919
House Type	Single pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	Gabled-interior: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-291

Address 285 Jones Dr

County Walton



NARGHIS ID 240922

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-292

Address 282 Jones Dr

County Walton



NARGHIS ID 240923

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Single pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 9/9
Chimney	No chimney observed
Alterations	Chimney removed; rear addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-293

Address 315 Jones Dr

County Walton



NARGHIS ID 240924

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Single pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double hung sash: 9/9
Chimney	Gable end interior: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-294

Address 317 Jones Dr

County Walton



NARGHIS ID 240925

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Single pen
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Masonite
Foundation	Continuous: concrete
Porch	Stoop
Windows	Double hung sash: 6/6, 4/4
Chimney	No chimney observed
Alterations	Replacement materials, chimney removed

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-295

Address 312 Jones Dr

County Walton



NARGHIS ID 240926

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-296

Address Approximately 280 Jones Drive

County Walton



NARGHIS ID 240927

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1955-1964
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-297

Address 336 Jones Dr

County Walton



NARGHIS ID 240928

Resource Type	Building
Resource Use	Residential: SIngle family dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Unknown
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-298

Address 342 Jones Dr

County Walton



NARGHIS ID 240929

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: concrete block
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chminey observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-299

Address Approximately 401 Walnut St

County Walton



NARGHIS ID 240930

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuos: concrete
Porch	Obscured
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-300

Address 140 N Cherokee Rd

County Walton



NARGHIS ID 65141

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1900-1909
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical revival
Roof	Complex
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: concrete block, brick
Porch	Wrap-around
Windows	Double hung sash: 1/1; Fixed
Chimney	No chminey observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-301 City Hall

Address 166 N Cherokee Rd

County Walton



NARGHIS ID 240326

Resource Type	Building
Resource Use	Government: City Hall
Date of Construction	1900-1909
House Type	Queen Anne house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian
Roof	Complex
Exterior Cladding	Wood:Weatherboard
Foundation	Concrete
Porch	Wrap-around
Windows	Double hung sash: 6/6; Fixed
Chimney	Gable end interior: brick
Alterations	Multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-302

Address 111 N Cherokee Rd

County Walton



NARGHIS ID 240327

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	New South cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk victorian
Roof	Complex
Exterior Cladding	Synthetic siding: Asbestos
Foundation	Continuous: Brick with stucco
Porch	Wrap-around
Windows	Double hung sash: 2/2
Chimney	Lateral exterior; Off-center within roof
Alterations	Addition, Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-303

Address Holly St at N Cherokee Rd

County Walton



NARGHIS ID 240328

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1905-1914
House Type	New South cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Complex
Exterior Cladding	Wood: Weatherboard
Foundation	Pier with infill: brick
Porch	Wrap-around
Windows	Double hung sash: 2/2
Chimney	Off-center ridgeline; Off-center within roof surf
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-304

Address 236 N Cherokee Rd

County Walton



NARGHIS ID 240329

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip; Gable
Exterior Cladding	Brick: common bond; Asbestos
Foundation	Unknown
Porch	No porch
Windows	Double hung sash: 6/1, 4/1; Triple hung sash
Chimney	Center: brick
Alterations	Replacement materials, multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-305

Address 294 N Cherokee Rd

County Walton



NARGHIS ID 240330

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1900-1909
House Type	Georgian house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Gable front; Complex
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: birck
Porch	Wrap-around; Balcony
Windows	Double hung sash: 1/1, 2/2; Fixed
Chimney	Off-center within roof surf: brick
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-306

Address 294 N Cherokee Rd

County Walton



NARGHIS ID 240334

Resource Type	Building
Resource Use	Commercial: Hotel
Date of Construction	1917
House Type	Georgian House
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Neoclassical
Roof	Hip; Pyramidal
Exterior Cladding	Brick: running bond
Foundation	Continuous
Porch	Verandah; Balcony
Windows	Double hung sash: 1/1; Fixed
Chimney	Off-center ridgeline: brick
Alterations	Rear addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-307 Roger Adams House

Address 330 N Cherokee Rd

County Walton



NARGHIS ID 240336

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1920-1929
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: cross
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Wrap-around
Windows	Double hung sash: 5/1; Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-308

Address 346 N Cherokee Rd

County Walton



NARGHIS ID 240338

Resource Type	Building
Resource Use	Residential: single family dwelling
Date of Construction	1929-1934
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	English vernacular revival
Roof	Gable: cross
Exterior Cladding	Brick: running
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash 1/1; Fixed
Chimney	Off-center ridgeline: brick
Alterations	Side addition

Preliminary Assessment Eligible

Status - Listed Listed

Applicable Criteria C

Social Circle Historic Resource

Resource ID SC-309 Mitchell Brown House

Address 362 N Cherokee Rd

County Walton



NARGHIS ID 240340

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1905-1914
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne
Roof	Gable: front; Hip
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: Brick, concrete block
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	Off-center within roof surf: brick
Alterations	Multiple additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-310

Address 378 N Cherokee Rd

County Walton



NARGHIS ID 240342

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1920-1929
House Type	Georgian house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial Revival
Roof	Gable: side; Hip
Exterior Cladding	Brick: running
Foundation	Continuous: brick
Porch	Verandah; Stoop
Windows	Double hung sash: 6/6; Fixed
Chimney	Off-center ridgeline: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-311

Address 394 N Cherokee Rd

County Walton



NARGHIS ID 240343

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Hip
Exterior Cladding	Synthetic siding: Asbestos
Foundation	Continuous: brick, concrete block
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Off-center within roof surf: brick
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-312

Address 400 N Cherokee Rd

County Walton



NARGHIS ID 240344

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: front; Hip
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Wrap-around
Windows	Double hung sash: 1/1; Fixed
Chimney	Off-center ridgeline: brick
Alterations	Rear addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-313

Address 416 N Cherokee Rd

County Walton



NARGHIS ID 240347

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1925-1934
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 8/1
Chimney	Center ridgeline: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-314

Address 426 N Cherokee Rd

County Walton



NARGHIS ID 240348

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1925-1934
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: cross
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 8/1
Chimney	Off-center ridgeline: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC- 315 Cook Smith House

Address 432 N Cherokee Rd

County Walton



NARGHIS ID 240349

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Gable: cross
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/1
Chimney	Gable end exterior: brick
Alterations	Addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-316

Address 462 N Cherokee Rd

County Walton



NARGHIS ID 240350

Resource Type	Building
Resource Use	Residential: single family dwelling
Date of Construction	1905
House Type	New South Cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Gable: front; Pyramidal
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Wrap-around
Windows	Double hung sash: 1/1; Fixed
Chimney	Off-center ridgeline: brick
Alterations	Rear addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-317

Address 482 N Cherokee Rd

County Walton



NARGHIS ID 240351

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1925-1934
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Off-center within roof surface: brick
Alterations	Enclosed verandah

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-318

Address 498 N Cherokee Rd

County Walton



NARGHIS ID 240352

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1889
House Type	Central hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: Brick
Porch	Verandah
Windows	Double hung sash: 2/1
Chimney	Both gable ends: brick
Alterations	Multiple additions

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-319

Address 524 N Cherokee Rd

County Walton



NARGHIS ID 240353

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1900-1909
House Type	Central hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Wood: Weatherboard
Foundation	Unknown
Porch	Verandah
Windows	Double hung sash: 9/9
Chimney	Both gable ends exterior: stucco
Alterations	Rear addition

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-320

Address 498 N Cherokee Rd

County Walton



NARGHIS ID 240350

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1900-1909
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Prefab panel; Insulbrick
Foundation	Continuous: concrete block
Porch	Verandah
Windows	Double hung sash: 2/2
Chimney	Off-center within surf: brick
Alterations	Enclosed porch, Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-321

Address 185 Spring St

County Walton



NARGHIS ID 240353

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1960-1969
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: common bond
Foundation	Continuous: brick
Porch	Stoop
Windows	Double hung sash: 6/6, 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-322

Address 304 S. Cherokee Rd.

County Walton



NARGHIS ID 240375

Resource Type	Building
Resource Use	Vacant
Date of Construction	1930-1939
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial: single retail
School Type	
Structural System	Unknown
Style	No academic style
Roof	Flat
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick; concrete
Porch	Recessed
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Store front alterations

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 323

Address Malcom Rd at N. Cherokee Rd

County Walton



NARGHIS ID 240557

Resource Type	Single Family Dwelling
Resource Use	Residential
Date of Construction	1940-1949
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Craftsman: Elements of style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Asbestos
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Gable end exterior:brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 324

Address 1148 N. Cherokee Rd

County Walton



NARGHIS ID 240558

Resource Type	Building
Resource Use	Vacant
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: Running bond
Foundation	Continuous: Brick
Porch	Portico
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	Additions

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 325

Address 1122 N. Cherokee Rd

County Walton



NARGHIS ID 240559

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1965-1974
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	Center within roof surface: brick
Alterations	

Preliminary Assessment
Potentially Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 326

Address 1096 N. Cherokee Rd

County Walton



NARGHIS ID 240560

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1930-1939
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: concrete
Porch	Portico
Windows	Double hung sash: 3/1
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Potentially eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-327

Address 1088 N. Cherokee Rd

County Walton



NARGHIS ID 240561

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1930-1939
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial: single retail
School Type	
Structural System	Concrete block
Style	No academic style
Roof	Gable: Parapet
Exterior Cladding	Concrete: block
Foundation	Continuous: concrete
Porch	No porch observed
Windows	Double hung sash: 6/6
Chimney	Center within roof surface: brick
Alterations	Rear addition

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 328

Address 1040 N. Cherokee Rd

County Walton



NARGHIS ID 240563

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1934-1945
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Craftsman: elements of style
Roof	Gable: front
Exterior Cladding	Brick: Veneer
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 4/4
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 329

Address 1082 N. Cherokee Rd

County Walton



NARGHIS ID 240593

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1945-1954
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: Parapet
Exterior Cladding	Synthetic siding: Asbestos
Foundation	Continuous: concrete
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC 330

Address 876 Tower Rd.

County Walton



NARGHIS ID 240595

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-331

Address 916 N Cherokee Rd

County Walton



NARGHIS ID 65094

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1900-1909
House Type	Gabled ell cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Brick: continuous
Porch	Verandah: front
Windows	Double hung: 2/2
Chimney	Gable end exterior; Lateral exterior: brick
Alterations	Additions; Replacement materials

Preliminary Assessment
Not eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-332

Address 752 N Cherokee Rd

County Walton



NARGHIS ID 240597

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1950-1959
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding; vinyl
Foundation	Continuous: brick
Porch	Verandah; Portico
Windows	Double hung sash: 1/1
Chimney	Gable end exterior: brick
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-333

Address 758 N Cherokee Rd

County Walton



NARGHIS ID 65095

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	English cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: multi
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Stoop
Windows	Double hung sash: 1/1, 6/6
Chimney	Gable end exterior: brick
Alterations	Mid century alterations

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-334

Address 192 Rose Ln

County Walton



NARGHIS ID 240598

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1950-1959
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Hip
Exterior Cladding	Brick: running bond
Foundation	Concrete: continuous
Porch	Stoop
Windows	Double hung sash: 2/2
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-335

Address 138 N Cherokee Rd

County Walton



NARGHIS ID 240599

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple block
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-336

Address 140 N Cherokee Rd

County Walton



NARGHIS ID 240600

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: multiple retail
School Type	
Structural System	Balloon Frame
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick: Running bond; Stucco
Foundation	Unknown
Porch	Stoop
Windows	Fixed bay
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-337

Address 146 N Cherokee Rd

County Walton



NARGHIS ID 240601

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Flat
Exterior Cladding	Brick
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	Store front alterations

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-338

Address 148 N Cherokee Rd

County Walton



NARGHIS ID 240602

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick
Foundation	Brick
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-339

Address 154 S Cherokee Rd

County Walton



NARGHIS ID 240603

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick: running bond
Foundation	Unknown
Porch	Recessed
Windows	Fixed: single pane
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed


Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-340

Address 156 Cherokee Rd

County Walton

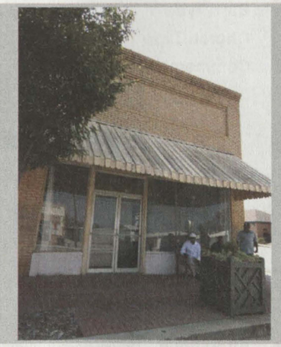

NARGHIS ID 240604

Resource Type	Building
Resource Use	Commercial: Single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial Block: multiple retail
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick: running bond
Foundation	Brick
Porch	No porch
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials; altered store front

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-341

Address 127 Hightower Trl

County Walton



NARGHIS ID 240605

Resource Type	Building
Resource Use	Commercial: Single Retail
Date of Construction	1880-1889
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: multiple retail
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick: running bond
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-342

Address 156 Cherokee Rd

County Walton



NARGHIS ID 240932

Resource Type	Building
Resource Use	Commercial: single retail
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: multiple retail
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Flat
Exterior Cladding	Brick: running bond
Foundation	Brick
Porch	Portico
Windows	Fixed
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-343

Address 137 Cherokee Rd

County Walton



NARGHIS ID 240606

Resource Type	Building
Resource Use	Commercial: Healthcare
Date of Construction	1900-1909
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: Multiple retail
School Type	
Structural System	Balloon frame
Style	Colonial revival
Roof	Flat
Exterior Cladding	Stucco
Foundation	Unknown
Porch	Recessed
Windows	Fixed
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-344

Address 156 Cherokee Rd

County Walton



NARGHIS ID 240933

Resource Type	Building
Resource Use	Commercial: Office
Date of Construction	1905-1914
House Type	
Barn Type	
Church Type	
Commercial Type	Commercial block: Multiple retail
School Type	
Structural System	Balloon Frame
Style	Colonial revival
Roof	Flat
Exterior Cladding	Stucco
Foundation	Unknown
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	Replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-345

Address 278 Forest Dr

County Walton



NARGHIS ID 240431

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1965-1974
House Type	Ranch
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: side
Exterior Cladding	Brick: running bond
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash: 6/6
Chimney	Gable end exterior: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-346

Address 145 Hickory Dr SW

County Walton



NARGHIS ID 240354

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic siding: Asbestos
Foundation	Continuous
Porch	Recessed
Windows	Double hung sash: 4/4
Chimney	Center ridgeline: brick
Alterations	

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-347

Address 137 Hickory Dr SW

County Walton



NARGHIS ID 240355

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Bungalow: front
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic siding: Masonite
Foundation	Continuous: brick
Porch	Enclosed
Windows	Double hung sash: 1/1
Chimney	Center: brick
Alterations	Addition; Enclosed porch

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-348

Address 139 Hickory Dr SW

County Walton



NARGHIS ID 240356

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1940-1949
House Type	Side gable cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double hung sash: 1/1
Chimney	Off-center within roof surf: brick
Alterations	Replacement materials; Enclosed porch

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-349

Address 301 S Cherokee Rd

County Walton



NARGHIS ID 240357

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Bungalow: front
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Recessed
Windows	Double hung sash : 6/1
Chimney	Off-center within roof surf: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-350

Address 305 S Cherokee Rd

County Walton



NARGHIS ID 240360

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Craftsman
Roof	Gable: front
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Stoop: front
Windows	Double hung sash: 1/1
Chimney	Center ridgeline: brick
Alterations	Material replacements

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-351

Address 315 S Cherokee Rd

County Walton



NARGHIS ID 240373

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: front gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: multi
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Verandah: front
Windows	Double hung sash: 2/2, 1/2; Fixed
Chimney	No chimney observed
Alterations	Addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-352

Address 303 N Cain St

County Walton



NARGHIS ID 240374

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1910-1919
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon Frame
Style	Folk Victorian
Roof	Gable: side
Exterior Cladding	Wood: Weatherboard
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6; 6/9
Chimney	Gabled end exterior: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-353

Address 284 S. Cherokee Rd

County Walton



NARGHIS ID 241007

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1925-1934
House Type	Bungalow: cross
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: cross
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 6/6, 2/2
Chimney	Off center ridgeline: brick
Alterations	Material replacements

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-354

Address 591 N Cherokee Rd

County Walton



NARGHIS ID 240589

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1950-1959
House Type	Bungalow: cross gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Post and beam
Style	No academic style
Roof	Gable: cross
Exterior Cladding	Brick: common bond
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 6/6
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Potentially eligible

Status - Listed
Not Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-355

Address 130 W Hightower Tr

County Walton



NARGHIS ID 65128

Resource Type	Building
Resource Use	Residential: Single Family Dwelling
Date of Construction	1930-1939
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Ballon frame
Style	Craftsman
Roof	Gable: side
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 3/1, 1/1
Chimney	Off center ridgeline: brick
Alterations	Screened side porch

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-356

Address 144 W Hightower Tr

County Walton



NARGHIS ID 242524

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1930-1939
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Portico
Windows	Double hung sash: 3/1
Chimney	Off center ridgeline: brick
Alterations	Material replacement, porch enclosure

Preliminary Assessment
Eilgible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-357

Address 162 W Hightower Tr

County Walton



NARGHIS ID 65127

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1930-1939
House Type	Bungalow: hip
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Craftsman
Roof	Hip; Gable: side
Exterior Cladding	Synthetic siding: Vinyl
Foundation	Stuccoed
Porch	Verandah
Windows	Double hung sash: 3/1, 6/6
Chimney	Center ridgeline: brick
Alterations	Extending side gable additions

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-358

Address Approximately 180 W Hightower Tr

County Walton



NARGHIS ID 242525

Resource Type	Building
Resource Use	Educational: school
Date of Construction	1955-1964
House Type	
Barn Type	
Church Type	
Commercial Type	
School Type	School building: multi-wing
Structural System	Poured concrete
Style	Moderne
Roof	Flat
Exterior Cladding	Concrete
Foundation	Continuous: concrete
Porch	No porch observed
Windows	Fixed, Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Multiple additions

Preliminary Assessment
Not Eligible

Status - Listed
Not listed

Applicable Criteria
A,C

Social Circle Historic Resource

Resource ID SC-359

Address 296 W Hightower Tr

County Walton



NARGHIS ID 65144

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1889
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 4/4, 6/6
Chimney	Off center within roof surface: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-360

Address 308 W. Hightower Tr

County Walton



NARGHIS ID 65125

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1885-1894
House Type	Queen Anne house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Wrap around; balcony
Windows	Fixed, Double hung sash: 25/1, 1/1
Chimney	Multiple random
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-361

Address 366 W. Hightower Tr

County Walton



NARGHIS ID 65124

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1890-1899
House Type	Queen Anne house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Queen Anne
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Wrap around; Balcony
Windows	Double hung sash: 1/1
Chimney	Off center within roof surface: brick
Alterations	Few replacement materials

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-362

Address 338 W Hightower Tr

County Walton



NARGHIS ID 65123

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1880-1889
House Type	Side hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Italiante
Roof	Pyramidal
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Verandah, stoop
Windows	Double hung sash: 2.2, Triple hung sash
Chimney	Off center within roof surface: brick (2)
Alterations	Historic additions

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-363

Address 511 W Hightower Tr

County Walton



NARGHIS ID 65122

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1867
House Type	Side hallway
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Italianate
Roof	Hip
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Stoop
Windows	Double hung sash: 2/2, Fixed
Chimney	Off center within roof surface: brick
Alterations	Historic addition

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-364

Address 417 S Cherokee Rd

County Walton



NARGHIS ID 242535

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1905-1914
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Continuous: brick
Porch	Wrap around
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-365

Address 379 S Cherokee Rd

County Walton



NARGHIS ID 242536

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1905-1914
House Type	Georgian cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Hip
Exterior Cladding	Synthetic siding: hip
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 4/4
Chimney	Off center within roof surface: brick (2)
Alterations	Material replacements, additions

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-366

Address 225 Cannon Dr

County Walton



NARGHIS ID 242537

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1915-1924
House Type	Bungalow: side gable
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Continuous: brick
Porch	Verandah
Windows	Double hung sash: 1/1
Chimney	No chimney observed
Alterations	Material replacements, additions and alterations

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-367

Address 303 Cain St

County Walton



NARGHIS ID 242538

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Queen Anne cottage
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	Folk Victorian
Roof	Complex
Exterior Cladding	Wood: weatherboard
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Gable end exterior: brick
Alterations	

Preliminary Assessment
Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-368

Address 324 Cedar St

County Walton



NARGHIS ID 242539

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Saddlebag
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 4/4, 6/6
Chimney	No chimney observed
Alterations	Replacement materials, alterations and addition

Preliminary Assessment
Not Eligible

Status - Listed
Listed

Applicable Criteria
C

Social Circle Historic Resource

Resource ID SC-369

Address 254 Cannon Dr

County Walton



NARGHIS ID 242540

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1910-1919
House Type	Saddlebag: 2 door
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Pier with infill: brick
Porch	Verandah
Windows	Double hung sash: 6/6
Chimney	Center: brick
Alterations	Replacement materials, alterations

Preliminary Assessment	Status - Listed	Applicable Criteria
Not Eligible	Listed	C

Social Circle Historic Resource

Resource ID SC-370

Address 412 Spring St

County Walton



NARGHIS ID 242541

Resource Type	Building
Resource Use	Residential: Single family dwelling
Date of Construction	1880-1889
House Type	I-house
Barn Type	
Church Type	
Commercial Type	
School Type	
Structural System	Balloon frame
Style	No academic style
Roof	Gable: side
Exterior Cladding	Synthetic siding: vinyl
Foundation	Unknown
Porch	Unknown
Windows	Double hung sash 6/6, Single hung sash
Chimney	Gable end exterior: brick
Alterations	Multiple additions, replacement materials

Preliminary Assessment	Status - Listed	Applicable Criteria
Not Eligible	Listed	C

Bibliography

- <>. "Georgia Historic Resources Survey Manual," Atlanta: Georgia Department of Natural Resources, Historic Preservation Division, 2000.
- <>. *Georgia's Living Places: Historic Houses in their Landscaped Setting* (1991), http://georgiashpo.org/sites/uploads/hpd/pdf/NR15arch_20080521100904_optimized.pdf (accessed September 10, 2012).
- <>. "How to Apply the National Register Criteria for Evaluation: National Register Bulletin 15," (Washington, D.C. : U.S. Government Printing Office, Department of the Interior, National Park Service, 1997.) http://www.nps.gov/nr/publications/bulletins/pdfs/nrb15.pdf
- Anderson Cordova, Karen and Burns, Leigh. *Preservation Primer: A Resource Guide for Georgia.* Atlanta: Georgia Department of Natural Resources, HPD, 2011.
- Ching, Frank. *A Visual Dictionary of Architecture,* New York : Van Nostrand Reinhold, 1995.
- Cloues, Richard. *The Ranch House in Georgia: Guidelines for Evaluation* Historic Preservation Division; available at http://issuu.com/georgiashpo/docs/ranch_house_guidelines?mode=window&backgroundColor=%23222222 (Accessed October12, 2012).
- Derry, Anne, Jandal, H. Ward, Shull, Carol D., and Thorman, Jan. "Guidelines for Local Surveys: A Basis for Preservation Planning. National Register Bulletin 24," Washington, D.C: U.S. Government Printing Office, Department of the Interior, National Park Service, 1985.) http://www.nps.gov/nr/publications/bulletins/pdfs/nrb24.pdf
- Lambin, Jeanne. "Preserving Resources from the Recent Past," Washington, D.C.: National Trust for Historic Preservation, 2007
- Lavandier, Jessica. "Fulton County Historic Resources Survey, North Fulton County Executive Summary," Georgia Department of Natural Resources, HPD, 1996.
- McAlaster, Virginia and Lee. A Field Guide to American Houses, New York: Alfred A, Knopf, Inc, 2003.

Owens Library
College of Environment & Design
University of Georgia



The University of Georgia
College of Environment + Design
Center for Community Design & Preservation
Phase I Historic Resource Survey
Social Circle, Georgia
August 2012

Chemistry Library - UCLA
3 2108 05752 2834